



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **SYMBOL**

Date : **9/7/2026**

Plate No. : **716546**

Time : **15:18**

Model : **2022** Color : **WHITE**

Type of Check : **Engine +chassis+paint....ONLY**

VIN: VF14SRAB8NT037169

80702KM

Scratches + dents on body + plastic kit + front left ring bend

Front left fender cold repaired + front face repaired

Small bend on rear chassis + valve sound on accelerator

Timing gasket leak + tune up engine + service petrol pedal

Change water tank + service for water circulation + temperature

Change engine belt + engine oil bolt + service for oxygen sensor

Service brake

Thank you for choosing Golden Munich cars inspection

Paint:

Rear bumper

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة موآتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

Renault Vehicle Diagnostic Report

Vehicle Information

--/Renault/LOGAN II/SANDERO II/
 VIN: VF14SRAB8NT037169

Odometer Reading: 80702km
 License Plate: --

Customer Information

Name: -- Tel: --

Device Information

Scanner: MaxiSys MS909EV
 Version: V15.30

Serial Number: VA9GR4C01193
 Repair Order Number:
 VA9GR4C0119320260709115628378

System Scanned (7)

System	Status/DTC
INJ(Injection)	5
BVA(Automatic gearbox)	0
ABS(Anti-lock braking system)	0
ABG(Airbag / pretensioners)	0
TDB(Instrument panel)	0
UCH(Central control unit)	5
RDO(Radio)	0

DTC (10)

INJ(Injection) (5 DTCs)

DTC	Description	Status
DTC013013	Upstream oxygen sensor circuit Open circuit	Memory
DTC0226F1	Brake/accelerator pedal positions Jammed accelerator pedal detected.	Memory
DTC211907	Motorised throttle unit control Motorised throttle idle position programming error.	Memory
DTC211975	Motorised throttle unit control Incorrect flap position in idle mode.	Memory
DTC211991	Motorised throttle unit control Value outside tolerances.	Memory

UCH(Central control unit) (5 DTCs)

DTC	Description	Status
-----	-------------	--------

DTC5A607B	Under-inflated Low fluid level	Memory
DTC5A727A	Wheel 1 flat Fluid leak or sealing failure	Memory
DTC5A737A	Wheel 2 flat Fluid leak or sealing failure	Memory
DTC5A747A	Wheel 3 flat Fluid leak or sealing failure	Memory
DTC5A757A	Wheel 4 flat Fluid leak or sealing failure	Memory

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

EOBD Vehicle Diagnostic Report

Vehicle Information

EOBD/ISO 15765-4(CAN)
VIN: VF14SRAB8NT037169
Path: EOBD>ISO 15765-4 (CAN)>Live data

Odometer Reading: --
License Plate: --
Sub Model: --

Customer Information


Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V2.20

Serial Number: VA9GR4C01193

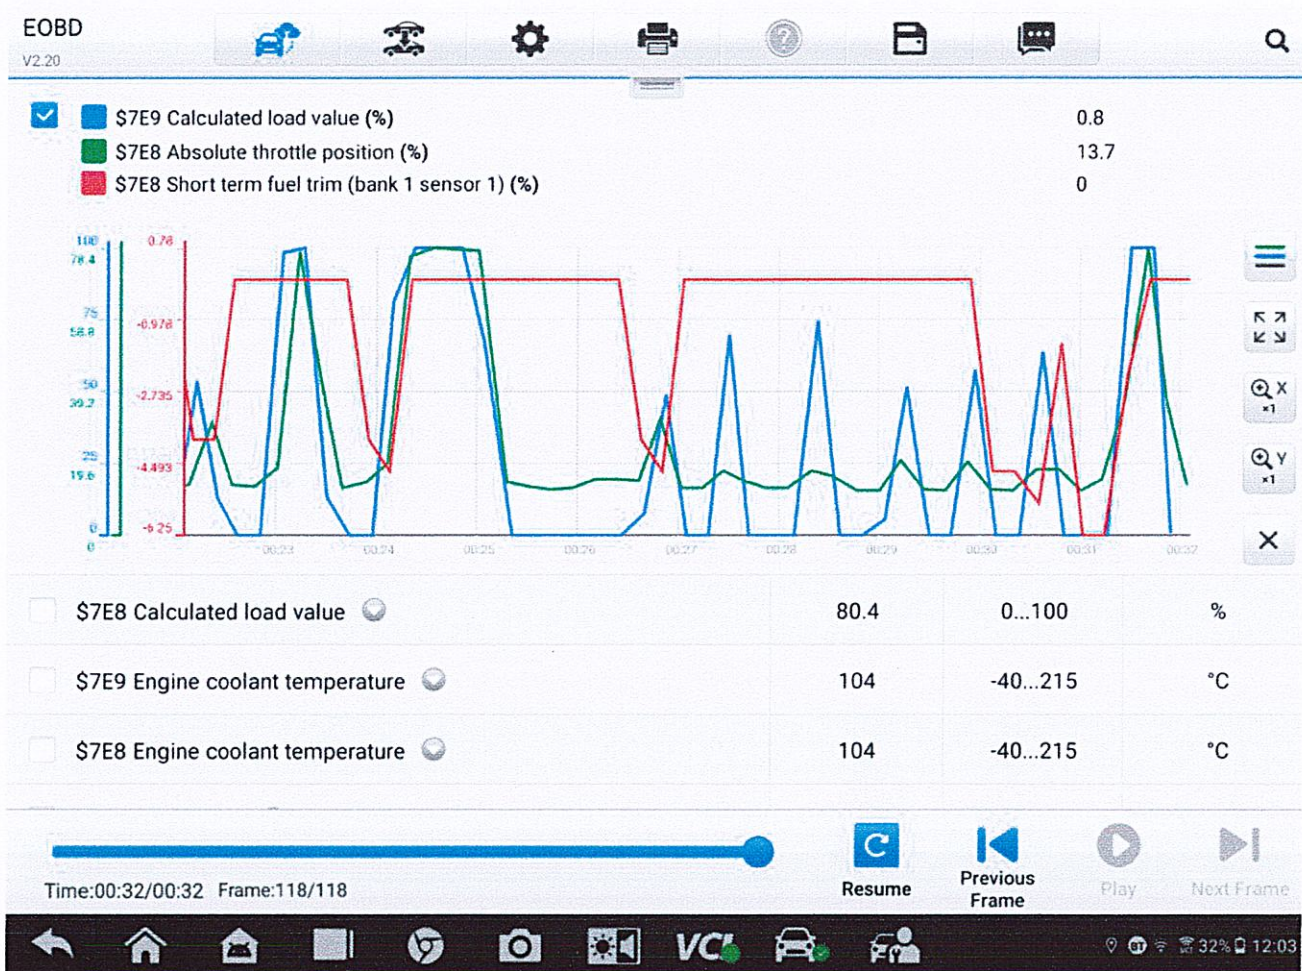

Engine 88%