



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **MG6**

Date : **15/8/2026**

Plate No. :

Time : **8:30**

Model : **2022** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN: **LSJW54U30NG048375**

116902KM

Change tyres + alignment

Scratches + dents on body + lower right body panel bend

Rear left fender repaired + under rear fender small bend

Under the car scratches by stones + rear iron bumper changed

Change stabilizer link bushes + engine mounting

Service for turbo + service brake + service for computer codes

Service for engine & gearbox (vibration)

Please check attached diagnosis computer report

Paint :

Plastic kit + all left side

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

Saicmg Vehicle Diagnostic Report

Vehicle Information

--/Saicmg/China/MG6(2019-2022) Auto/1.5T/
VIN: LSJW54U30NG048375

Odometer Reading: 116902km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.81

Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260815083829317

System Scanned (8)

System	Status/DTC
EMS (Engine Management System)	 4
TCM (Transmission Control Module)	 1
ABS (Antilock Brake System) / SCS (Stability Control System)	 3
SDM (Sensing Diagnostic Module)-SDM (Sensing Diagnostic Module)	 0
ATC (Automatic Temperature Control)	 3
PEPS (Passive Entry Passive Start)	 0
GW (Gateway)	 4
EPS (Electric Power Steering)	 0

DTC (15)

EMS (Engine Management System) (4 DTCs)

DTC	Description	Status
P029900	Turbocharger Underboost	Aging
P070000	Transmission Control Module (TCM) error - TCM requests MIL on	Intermittent
P085111	Neutral switch signal inconsistent with CAN signal - gear N/P not engaged displayed by CAN, gear N/P engaged displayed by sensor	Aging
P085111	Park/neutral switch input circuit low	Aging

TCM (Transmission Control Module) (1 DTC)

DTC	Description	Status
P08412A	Hydraulic oil pressure sensor signal stuck in range	Intermittent

ABS (Antilock Brake System) / SCS (Stability Control System) (3 DTCs)

DTC	Description	Status
C120700	Tyre Pressure Monitoring System (TPMS) Diffusion Warning	Intermittent
C180502	Electric Park Brake (EPB) switch signal invalid	Intermittent
C112224	Auto Hold (AVH) switch error	Intermittent

ATC (Automatic Temperature Control) (3 DTCs)

DTC	Description	Status
U156316	Battery Voltage Low	Aging
B144201	Left distribution flap actuator blockage	Intermittent
B147201	Front Blower Analog Control Error	Aging

GW (Gateway) (4 DTCs)

DTC	Description	Status
U156316	Module power supply circuit voltage too low	Aging
B116717	KLR relay high side drive circuit switch on failure	Aging
P082696	Shift paddle switch signal stuck	Aging
P19101C	Remote PRND display module (RPD) system operating voltage out of operating range	Aging

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

Saicmg Vehicle Diagnostic Report

Vehicle Information

Saicmg/China/MG6(2019-2022) Auto/1.5T
VIN: LSJW54U30NG048375
Path: Saicmg>Automatic selection>Auto scan>EMS (Engine Management System)>Live data

Odometer Reading: 116902 km
License Plate: --
Sub Model: --

Customer Information


Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.81

Serial Number: VA9GR4C01193

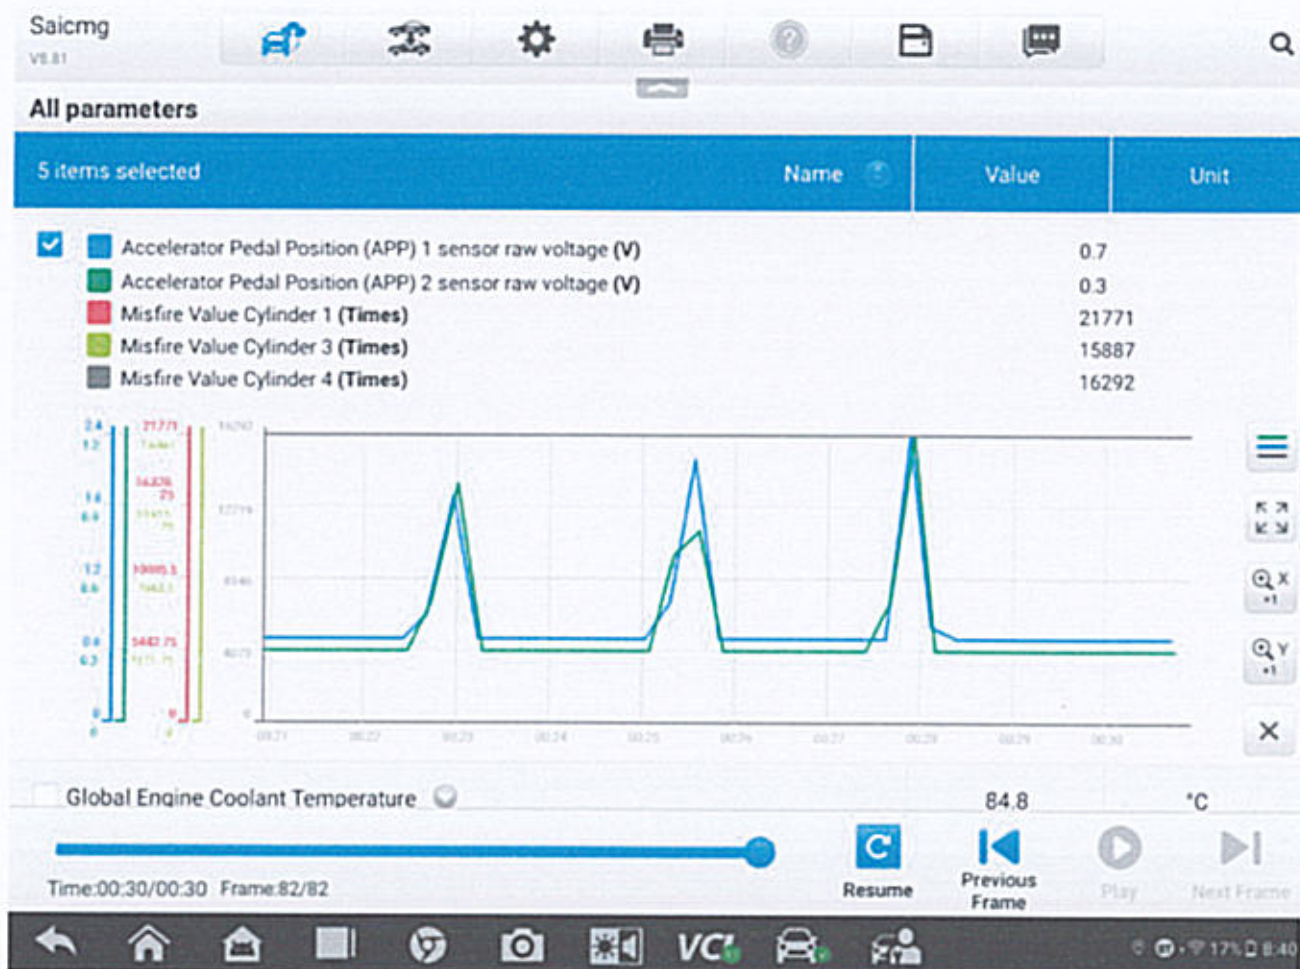

Engine: 88%