



ميونخ الذهبي لفحص السيارات ذ.م.م.

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **MG ZS**

Date : **15/8/2026**

Plate No. : **166469**

Time : **11:00**

Model : **2023** Color : **SILVER**

Type of Check : **Engine +gear+chassis+paint**

VIN: LSJW74U32PZ131839

47562KM

Change tyres + alignment

Scratches + dents on body

Water pump leak + service for water circulation & temperature

Service brake + computer codes + tune up engine

Please check attached diagnosis computer report

Paint :

Rear bumper + rear right fender

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواثر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

Saicmg Vehicle Diagnostic Report

Vehicle Information

--/Saicmg/China/NEW MG ZS(2020)/

VIN: LSJW74U32PZ131839

Odometer Reading: 47562km

License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV

Version: V8.81

Serial Number: VA9GR4C01193

Repair Order Number:

VA9GR4C0119320260815113120685

System Scanned (7)

System	Status/DTC
TCM (Transmission Control Module)-TCM (Transmission Control Module)	 0
ABS (Antilock Brake System) / SCS (Stability Control System)	 5
IPK (Instrument Pack)	 0
TPMS (Tyre Pressure Monitoring System)	 0
BCM (Body Control Module)	 2
ATC (Automatic Temperature Control)	 1
EPS (Electric Power Steering)	 1

DTC (9)

ABS (Antilock Brake System) / SCS (Stability Control System) (5 DTCs)

DTC	Description	Status
C002071	ABS pump motor control	Intermittent
C110604	Valve General Failure	Intermittent
C18052A	Electric Park Brake (EPB) switch blocked timeout	Aging
U042881	Invalid Steering Wheel Angle Data Received	Intermittent
U156316	Battery Voltage Low	Aging

BCM (Body Control Module) (2 DTCs)

DTC	Description	Status
B106673	Brake pedal switch stuck	Intermittent
U012787	Lost communication with TPMS	Intermittent

ATC (Automatic Temperature Control) (1 DTC)

DTC	Description	Status
-----	-------------	--------

U010087 Lost communication with ECM

Aging

EPS (Electric Power Steering) (1 DTC)

DTC	Description	Status
C163400	Steering Angle Initialization Error	Intermittent

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

Saicmg Vehicle Diagnostic Report

Vehicle Information

Saicmg/China/NEW MG ZS(2020)
VIN: LSJW74U32PZ131839
Path: Saicmg>Automatic selection>Auto scan>EMS (Engine Management System)>Trouble Codes

Odometer Reading: 47562 km
License Plate: --
Sub Model: --

Customer Information


Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.81

Serial Number: VA9GR4C01193

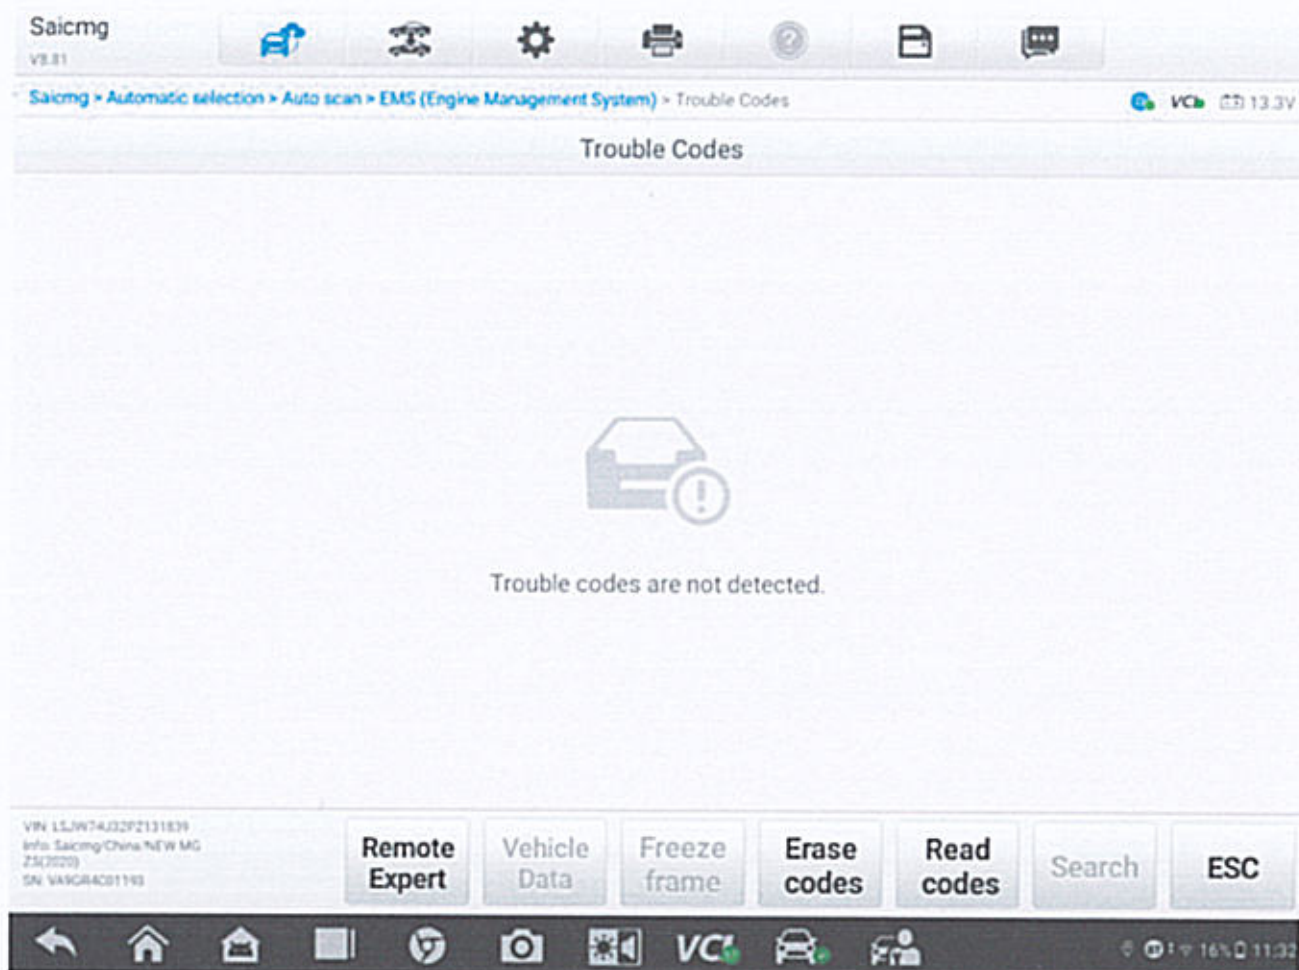

Saicmg Vehicle Diagnostic Report

Vehicle Information

Saicmg/China/NEW MG ZS(2020)
VIN: LSJW74U32PZ131839
Path: Saicmg>Automatic selection>Auto scan>EMS (Engine Management System)>Live data

Odometer Reading: 47562 km
License Plate: --
Sub Model: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.81

Serial Number: VA9GR4C01193



Engine: 93%