



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : MG 5	Date : 12/9/2026
Plate No. : 892100	Time : 13:17
Model : 2023 Color : WHITE	Type of Check : Engine +gear+chassis+paint

VIN: **LSJA36E33PZ032009**

167587KM

Change tyres + alignment + rims scratched
Scratches + dents on body + plastic kit + body paint damage
Front bumper & front bumper grill loose + lower left panel bend
Lower cover broken + rear body face + rear iron bumper bend
Rear head chassis bend + timing gasket leak
Change stabilizer link bushes + front arm bushes + spark plug
Service for traction control + service brake + interior leather

Thank you for choosing Golden Munich cars inspection

Paint:

Rear bumper + rear body door

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده
* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar
Mawater City - Rawdat Rashed - Qatar
Al Kheesa Qatar
Customer Service

+974 66338337
+974 66332237
+974 66332237
+974 40082021

طريق سلوى - عين خالد - قطر
مدينة موآتر - روضة راشد - قطر
الخيصة - قطر
خدمة العملاء

Saicmg Vehicle Diagnostic Report

Vehicle Information

--/Saicmg/China/MG5/2023-/
VIN: LSJA36E33PZ032009Odometer Reading: 167587km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.82Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260912130854344

System Scanned (5)

System	Status/DTC
ABS (Antilock Brake System) / SCS (Stability Control System)	 2
SDM (Sensing Diagnostic Module)	 0
IPK (Instrument Pack)	 0
BCM (Body Control Module)	 2
EPS (Electric Power Steering)	 1

DTC (5)

ABS (Antilock Brake System) / SCS (Stability Control System) (2 DTCs)

DTC	Description	Status
C005129	Steering Wheel Angle Not Initialized after Power-on Reset	Intermittent
U042881	Invalid Steering Wheel Angle Data Received	Intermittent

BCM (Body Control Module) (2 DTCs)

DTC	Description	Status
B106673	Brake Pedal Switch Stuck	Intermittent
B112A71	Drivers Door Window Switch Stuck Switch	Aging

EPS (Electric Power Steering) (1 DTC)

DTC	Description	Status
U041681	Invalid data received from dynamic Stability Control System (SCS)	Currently

Technician Notes

EOBD Vehicle Diagnostic Report

Vehicle Information

EOBD/ISO 15765-4(CAN)
VIN: LSJA36E33PZ032009
Path: EOBD>ISO 15765-4 (CAN)>DTC&FFD

Odometer Reading: --
License Plate: --
Sub Model: --

Customer Information


Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V2.21

Serial Number: VA9GR4C01193

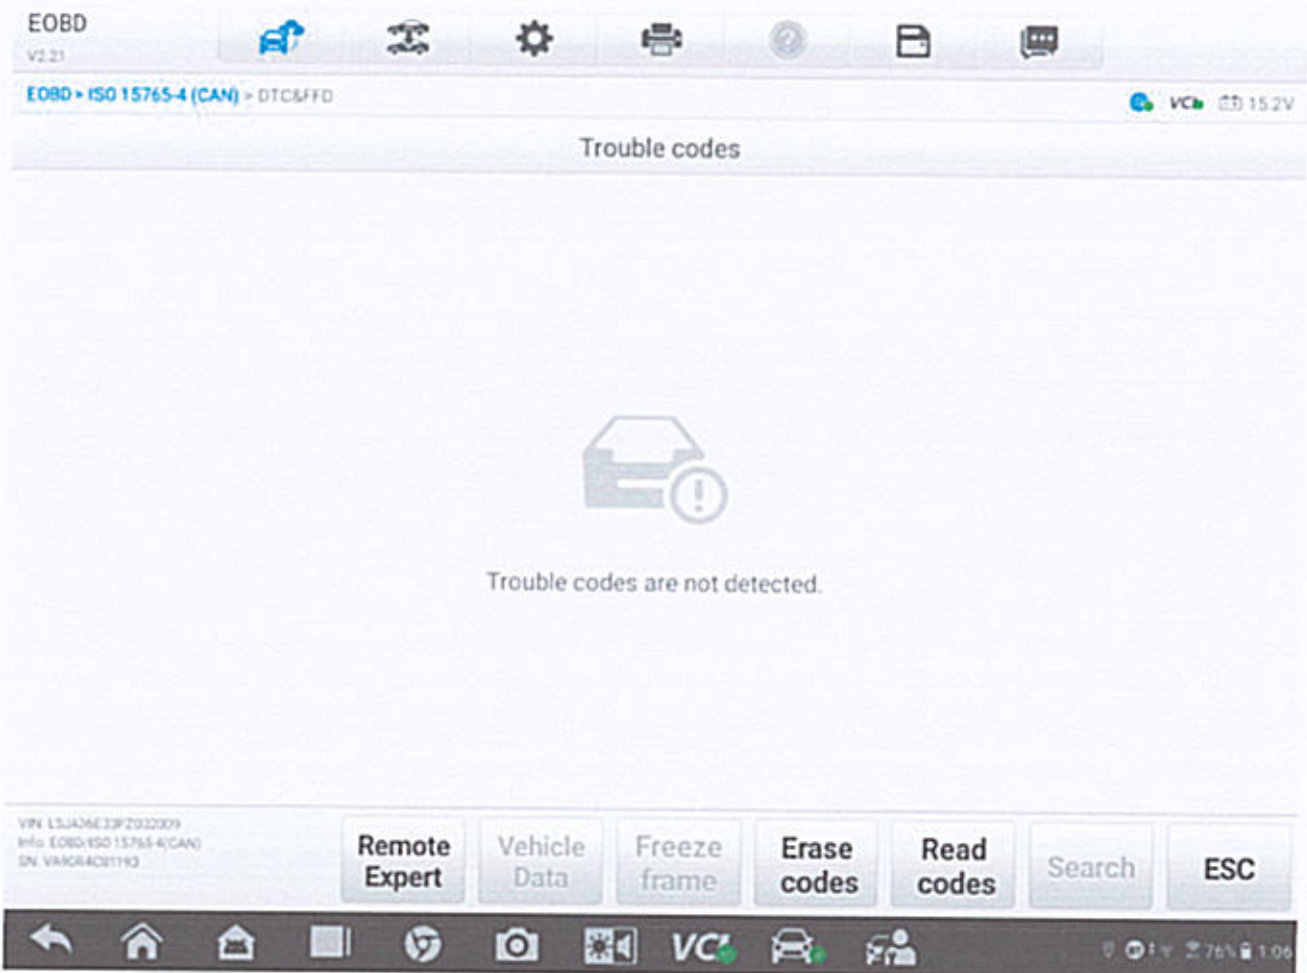

EOBD Vehicle Diagnostic Report

Vehicle Information

EOBD/ISO 15765-4(CAN)
VIN: LSJA36E33PZ032009
Path: EOBD>ISO 15765-4 (CAN)>Live data

Odometer Reading: -
License Plate: -
Sub Model: -

Customer Information


Name: -

Tel: -

Device Information

Scanner: MaxiSys MS909EV
Version: V2.21

Serial Number: VA9GR4C01193

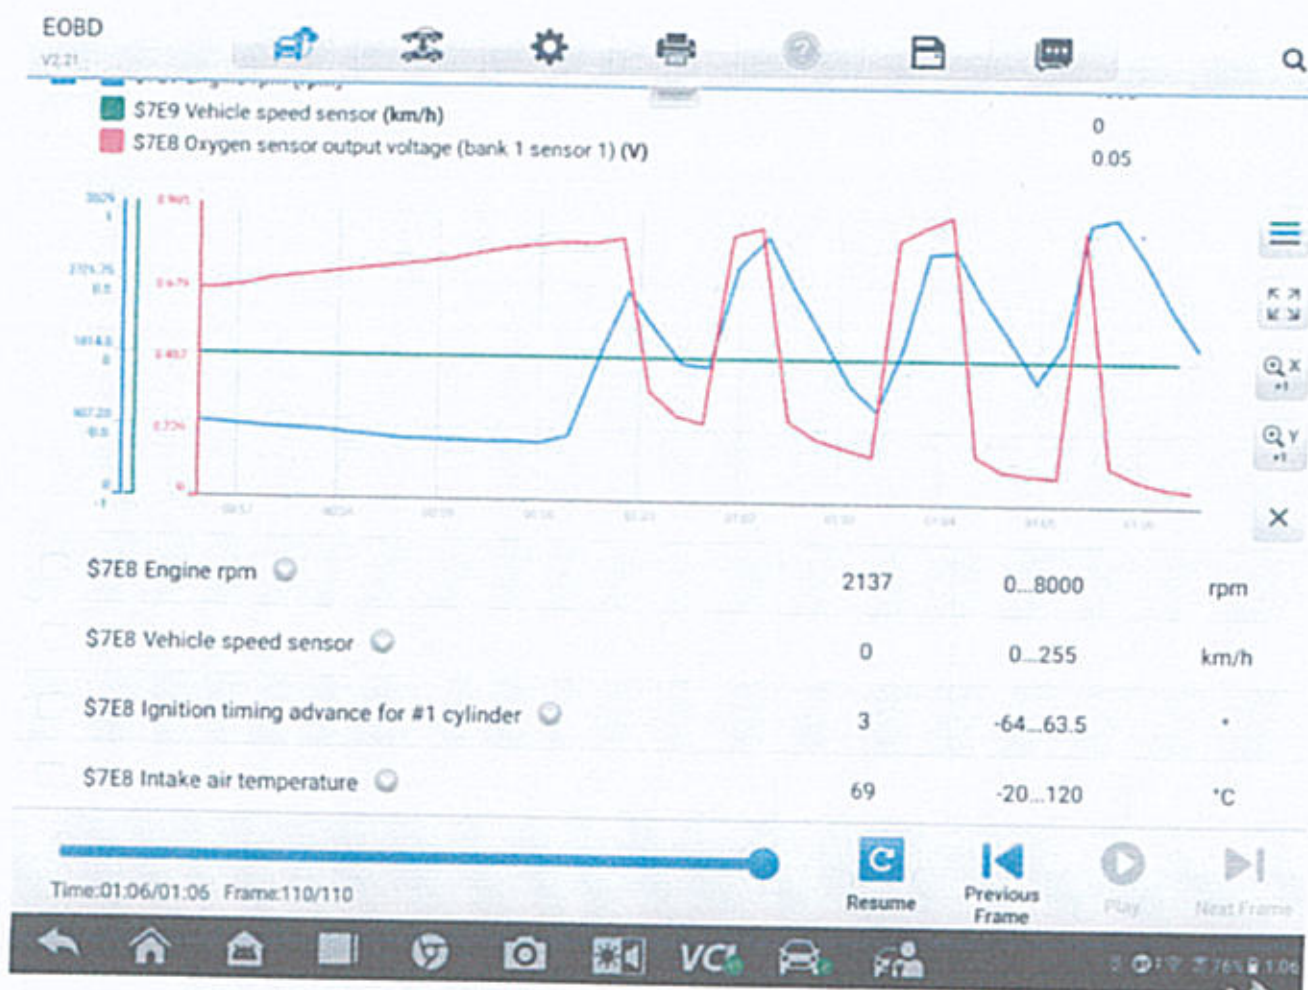

Engine 89%