



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **CAMRY**

Date : **9/7/2026**

Plate No. : **956015**

Time : **11:30**

Model : **2023** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN: JTNB14HK5P3190174

69931KM

Change tyres + alignment

Scratches + dents on ody + rear bumper loose

Rear fender two side repaired + body paint damage

Under the car scratches by stones + lower cover broken

Please check attached diagnosis computer report

Paint :

Plastic kit

Rear right fender

Rear left door + rear left fender

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

Mawater City - Rawdat Rashed - Qatar

+974 66332237

Al Kheesa Qatar

+974 66332237

Customer Service

+974 40082021

طريق سلوى - عين خالد - قطر

مدينة مواتر - روضة راشد - قطر

الخيصة - قطر

خدمة العملاء

08/2022- Toyota Vehicle Diagnostic Report

Vehicle Information

08//Toyota/Camry/A25A-FKS

VIN: JTNB14HK5P3190174

Odometer Reading: 69931 km

License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV

Version: V7.43

Serial Number: VA9GR4C01193

Repair Order Number:

VA9GR4C0119320260709111545201



System Scanned (23)

System	Status/DTC
Engine	✓ 0
Transmission	✓ 0
Brake/EPB	✗ 1
SRS airbag	✓ 0
Combination meter	✓ 0
Tire pressure monitor	✓ 0
Main body	✗ 1
Master switch	✓ 0
Driver door motor	✓ 0
Wiper	✓ 0
Passenger door motor	✓ 0
Left rear door motor	✗ 1
Right rear door motor	✓ 0
Sliding roof	✓ 0
Air conditioner	✗ 4
Entry&Start	✓ 0
Power source control	✓ 0
Navigation system	✓ 0
Starting control	✓ 0
Central gateway	✓ 0

ADAS

Steering angle sensor (SAS)			0
EMPS			0
Radar cruise 1			0

 DTC (7)**Brake/EPB (1 DTC)**

DTC	Description	Status
C060962	Electric parking brake switch signal compare failure	Confirmed

Main body (1 DTC)

DTC	Description	Status
B1245	Lost communication with wiper electronic control unit(ECU) LIN	History

Left rear door motor (1 DTC)

DTC	Description	Status
B2312	Power window switch of left rear door fault	History

Air conditioner (4 DTCs)

DTC	Description	Status
B1441	Air mix damper control servomotor circuit (passenger)	Current
B1441	Air mix damper control servomotor circuit (passenger)	History
B1443	Air outlet damper control servomotor circuit	History
B1497	Communication fault (bus IC)	History

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

Vehicle Diagnostic Report

Date&Time: 07/09/2026 11:41

Path:

VIN:

Toyota

V7.20



All parameters


3 items selected

Name

Value

Unit

- ☒ Calculate load (%) 14.1
- ☒ Engine speed (rpm) 2016
- ☒ Throttle sensor voltage % (%) 16.9

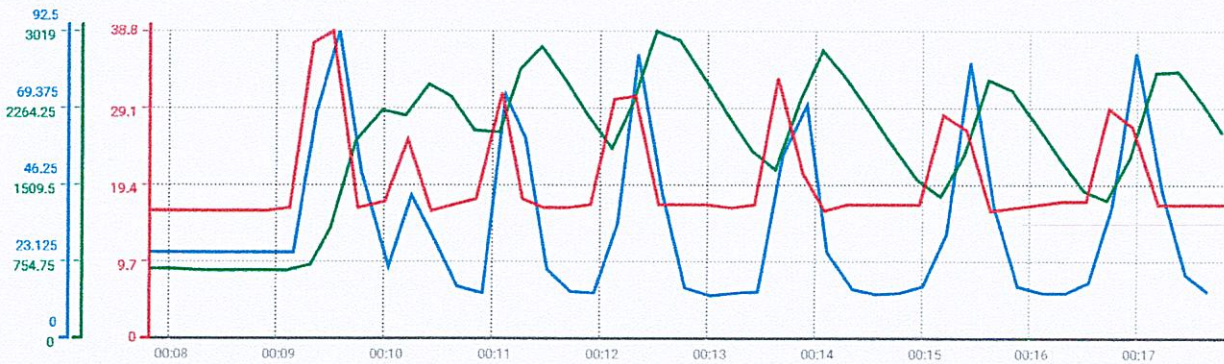

☐ Coolant temperature 76 °C

Time:00:17/00:17 Frame:68/68

Resume

Previous Frame

Play

Next Frame



BT 57% 12:06

Engine: 941