



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة  
Computerized Testing For All Kind of Cars



Car : **COROLLA CROSS**

Date : **9/7/2026**

Plate No. : **661603**

Time : **9:00**

Model : **2022** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

**VIN: RKLKUBAG0N0500965**

**57964KM**

Scratches + dents on body + cover under the car damage

Please check attached diagnosis computer report

**Paint :**

Front bumper + front left fender

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

\* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar  
Mawater City - Rawdat Rashed - Qatar  
Al Kheesa Qatar  
Customer Service

+974 66338337  
+974 66332237  
+974 66332237  
+974 40082021

طريق سلوى - عين خالد - قطر  
مدينة مواتر - روضة راشد - قطر  
الخيصة - قطر  
خدمة العملاء

# -05/2022 Toyota Vehicle Diagnostic Report

## Vehicle Information

-05/Toyota/Corolla cross/--  
VIN: RKLKUBAG0N0500965

Odometer Reading: 57964 km  
License Plate: --

## Customer Information

Name: --

Tel: --

## Device Information

Scanner: MaxiSys MS909EV  
Version: V7.43

Serial Number: VA9GR4C01193  
Repair Order Number:  
VA9GR4C0119320260709084542864

## System Scanned ( 19 )

| System                      | Status/DTC |
|-----------------------------|------------|
| Engine and ECT              | 1          |
| Brake                       | 2          |
| SRS airbag                  | 0          |
| Combination meter           | 2          |
| Tire pressure monitor       | 0          |
| Main body                   | 2          |
| Master switch               | 0          |
| Driver door motor           | 0          |
| Right rear door motor       | 1          |
| Left rear door motor        | 0          |
| Passenger door motor        | 1          |
| Air conditioner             | 0          |
| Navigation system           | 0          |
| Telematics                  | 0          |
| Radar cruise 1              | 0          |
| EMPS                        | 0          |
| Central gateway             | 0          |
| Steering angle sensor (SAS) | 0          |
| Immobilizer                 | 0          |

## DTC ( 9 )

**Engine and ECT ( 1 DTC )**

| DTC   | Description  | Status  |
|-------|--------------|---------|
| P1605 | Rough idling | History |

**Brake ( 2 DTCs )**

| DTC     | Description                                                          | Status    |
|---------|----------------------------------------------------------------------|-----------|
| C137BA2 | Brake system control module "A" system voltage system voltage low    | Confirmed |
| C14FE14 | Steering angle sensor supply voltage circuit short to ground or open | Confirmed |

**Combination meter ( 2 DTCs )**

| DTC     | Description                                                        | Status    |
|---------|--------------------------------------------------------------------|-----------|
| U016387 | Lost communication with navigation control module missing message  | Confirmed |
| B132187 | Lost communication with electro multi vision (EMV) missing message | Confirmed |

**Main body ( 2 DTCs )**

| DTC   | Description                                                           | Status  |
|-------|-----------------------------------------------------------------------|---------|
| B1247 | Tire pressure monitor electronic control unit(ECU) lost communication | History |
| U0163 | Lost communication with navigation control module                     | History |

**Right rear door motor ( 1 DTC )**

| DTC   | Description                                  | Status  |
|-------|----------------------------------------------|---------|
| B2312 | Power window switch of right rear door fault | History |

**Passenger door motor ( 1 DTC )**

| DTC   | Description                                 | Status  |
|-------|---------------------------------------------|---------|
| B2312 | Power window switch of passenger door fault | History |

**Technician Notes**

Customer name: \_\_\_\_\_

Technician: \_\_\_\_\_

Date: \_\_\_\_\_

Note: Please save a copy of this report for your records.

# -05/2022 Toyota Vehicle Diagnostic Report

## Vehicle Information

-05/2022/Toyota/Corolla cross  
VIN: RKLKUBAG0N0500965  
Path: Toyota>Automatic selection>Corolla cross>Europe/Others>ZSG10>Taiwan, China Product>-05/2022>Radar cruise>Without smart key>Auto scan>Engine and ECT>Live data

Odometer Reading: 57964 km  
License Plate: --  
Sub Model: --

## Customer Information


Name: --

Tel: --

## Device Information

Scanner: MaxiSys MS909EV  
Version: V7.43

Serial Number: VA9GR4C01193

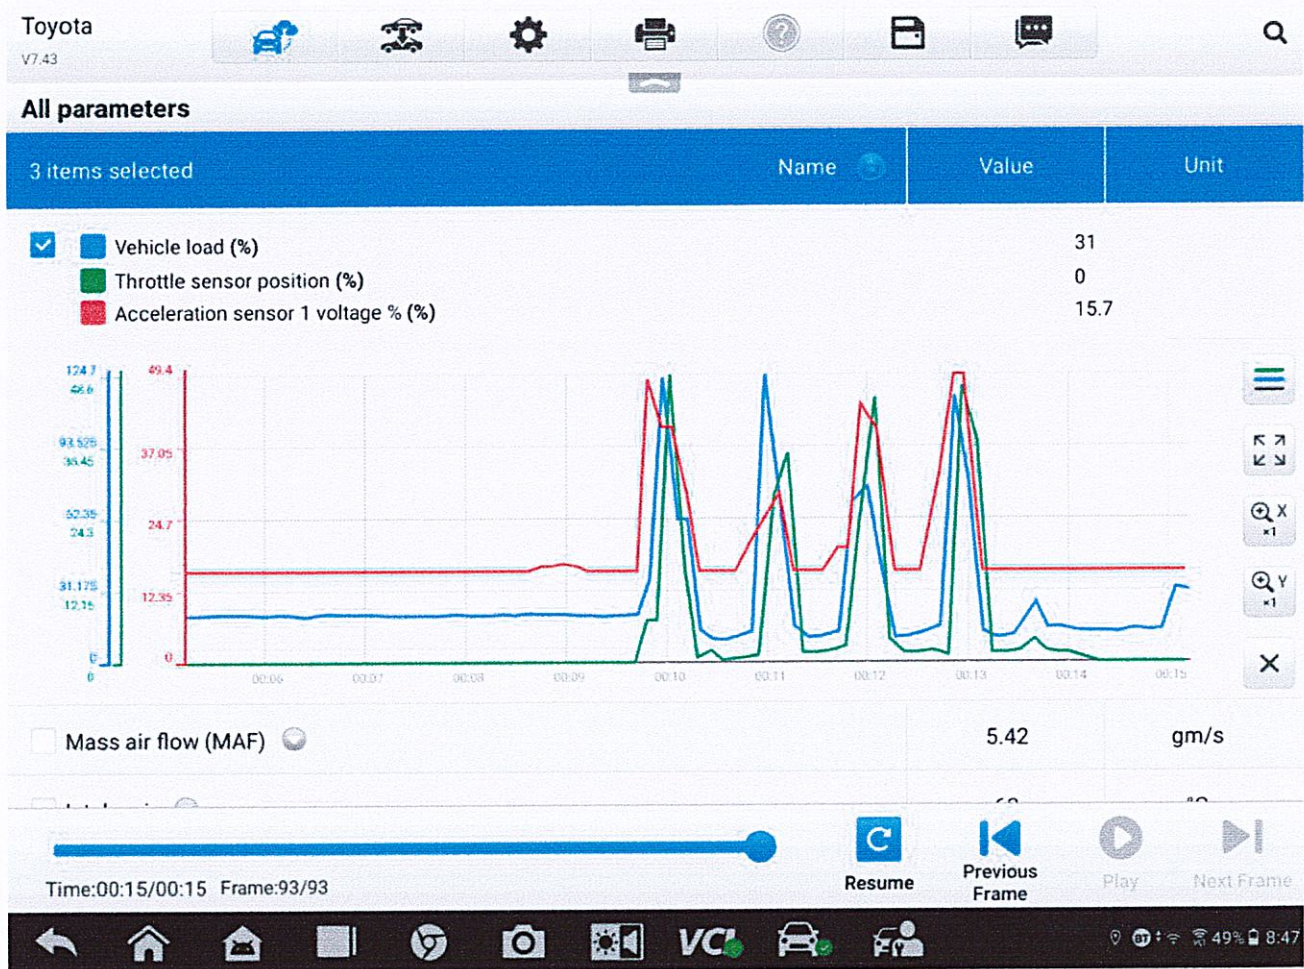

Engine: 95%