



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : GAC GS3

Date : 15/8/2026

Plate No. : 105432

Time : 13:50

Model : 2024 Color : WHITE

Type of Check : Engine +gear+chassis+paint

VIN: LMWHR1G20R1106265

70513KM

Change front tyres + alignment

Scratches + dents on body + plastic kit + body paint damage

Small rust under the car

Thank you for choosing Golden Munich cars inspection

Paint:

Plastic kit + 1/2 rear body door

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

GACMotor Vehicle Diagnostic Report

Vehicle Information

--/GACMotor/GS3 Power/
VIN: LMWHR1G20R1106265Odometer Reading: --
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V10.10Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260815132709763

System Scanned (7)

System	Status/DTC
EMS (Engine Management System)	 0
A/T (Automatic transmission)	 2
BCS (Brake Control System)	 2
SRS (Supplementary Restraint System)	 1
EPS (Electric Power Steering)	 1
RPA (Reversing Parking Aid)	 3
GWM (Gateway Module)	 6

ADAS

DTC (15)

A/T (Automatic transmission) (2 DTCs)

DTC	Description	Status
P113211	Manual downshift switch circuit short to ground or sticking	History DTC
U013987	Lost communication with BCM/gateway	History DTC

BCS (Brake Control System) (2 DTCs)

DTC	Description	Status
U014087	CAN communication error (BCM/GWM)	History DTC
C100118	ECU voltage too low	History DTC

SRS (Supplementary Restraint System) (1 DTC)

DTC	Description	Status
U014687	Lost communication with gateway	History DTC

EPS (Electric Power Steering) (1 DTC)

DTC	Description	Status
U014087	GWM node communication lost	Current DTC

RPA (Reversing Parking Aid) (3 DTCs)

DTC	Description	Status
B210016	Battery voltage low	History DTC
U014087	Lost communication with BCM signal sent by gateway	History DTC
U012987	Lost communication with BCS signal sent by gateway	History DTC

GWM (Gateway Module) (6 DTCs)

DTC	Description	Status
B280016	Gateway controller supply voltage low	History DTC
U007480	Unable to check other B-CAN nodes	History DTC
U010087	Lost communication with Engine Management System (EMS)	History DTC
U012987	Lost communication with BCS	History DTC
U012687	Lost communication with Steering Angle Sensor (SAS)	History DTC
U013187	Lost communication with Electric Power Steering (EPS)	History DTC

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

GACMotor Vehicle Diagnostic Report

Vehicle Information

GACMotor/GS3 Power
VIN: LMWHR1G20R1106265
Path: GACMotor>Automatic selection>Auto scan>EMS (Engine Management System)>Live data

Odometer Reading: --
License Plate: --
Sub Model: --

Customer Information


Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V10.10

Serial Number: VA9GR4C01193

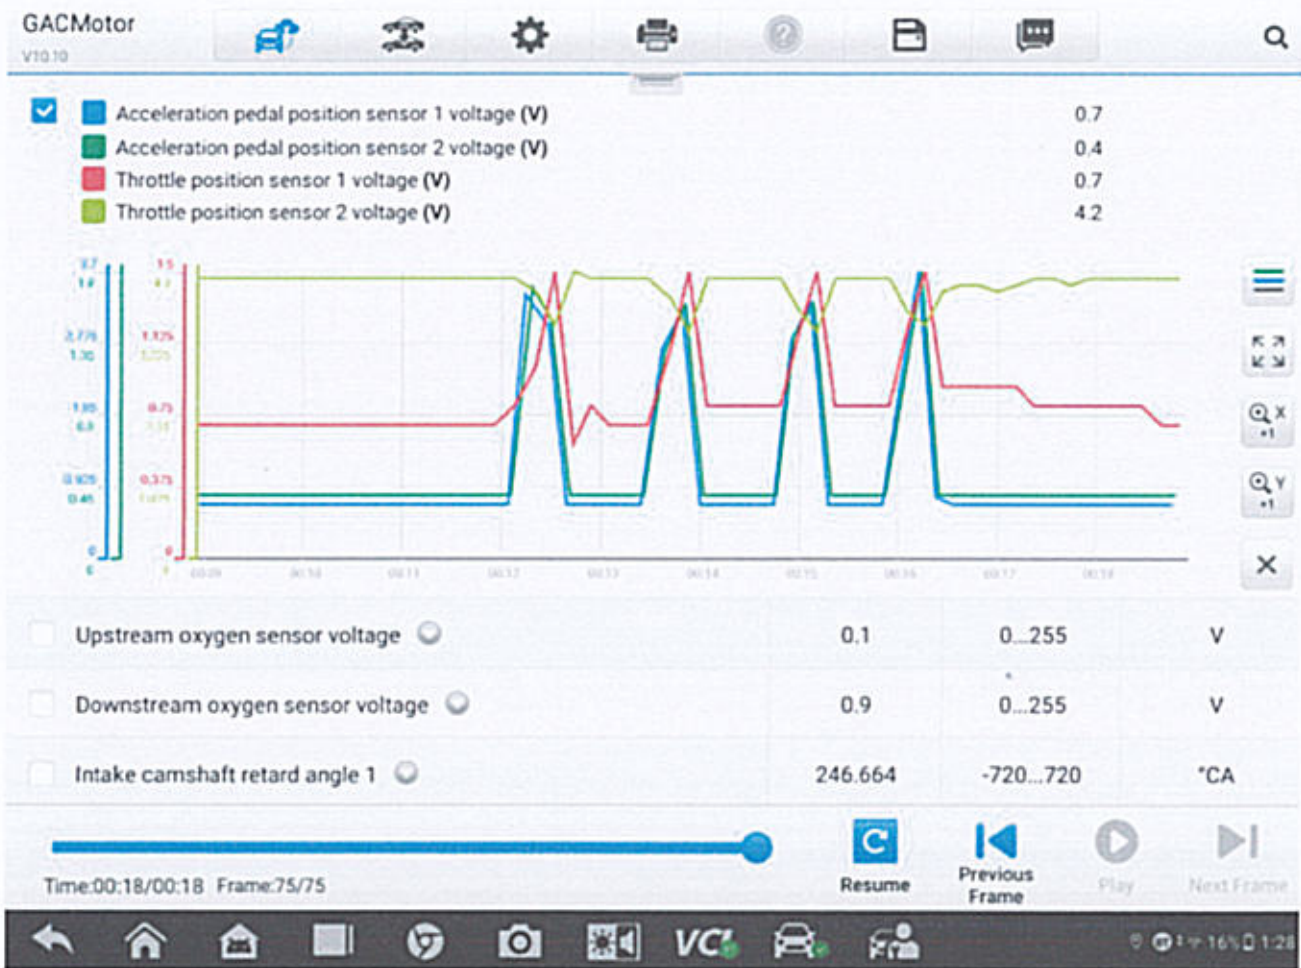

Engine 92 /