



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **RX5**

Date : **15/8/2026**

Plate No. : **902117**

Time : **10:00**

Model : **2023** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN: LSJA24U33PS031198

47052KM

Scratches + dents on body + front bumper grille broken

Front face sand damage + rear body door bend

Rear iron bumper bend

Service for gearbox code (U41786)

Please check attached diagnosis computer report

Paint:

1/2 Front bumper + bonnet

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examonation or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة موآتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

Saicmg Vehicle Diagnostic Report

Vehicle Information

--/Saicmg/Middle East/MG RX5/
VIN: LSJA24U33PS031198Odometer Reading: 47052km
License Plate: --

Customer Information

Name: --


Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.81Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260815103031759

System Scanned (12)

Topology

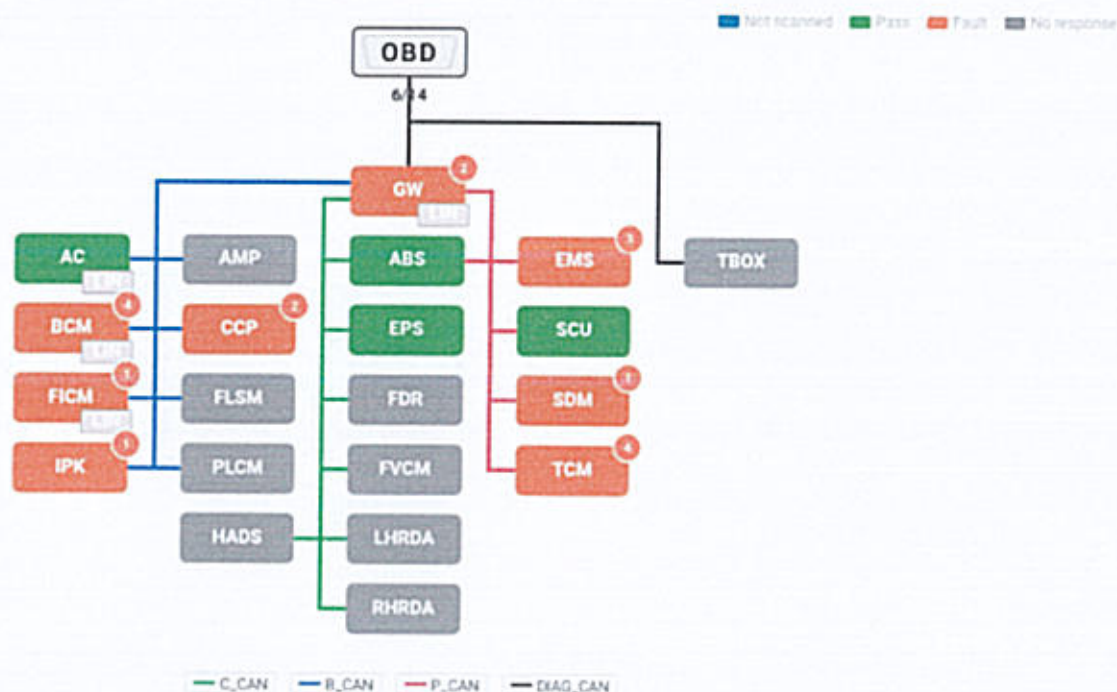

System

Status/DTC

EMS (Engine Management System)	✓ 0
TCM (Transmission Control Module)	✗ 4
ABS (Antilock Brake System) / SCS (Stability Control System)	✓ 0
SDM (Sensing Diagnostic Module)	✓ 0
IPK (Instrument Pack)	✓ 0
BCM (Body Control Module)	✓ 0
CCP (Central Communication Processor)	✓ 0

EPS (Electric Power Steering)	✓ 0
FICM (Front Infotainment Control Module)	✓ 0
GW (Gateway)	✓ 0
ATC (Automatic Temperature Control)	✓ 0
SCU (Shift Control Unit)	✓ 0

 DTC (4)**TCM (Transmission Control Module) (4 DTCs)**

DTC	Description	Status
U028787	Lost communication with Clutch Cooling Electric Oil Pump (CCEOP)	Intermittent
U012287	Lost communication with Stability Control System (SCS)	Intermittent
^f U041786	CAN bus signal error - Electric Park Brake (EPB) signal unknown	Aging
U182A82	CAN bus frame rolling counter fault - Electric Park Brake (EPB)	Aging

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

Saicmg Vehicle Diagnostic Report

Vehicle Information

Saicmg/Middle East/MG RX5
VIN: LSJA24U33PS031198
Path: Saicmg>Manual selection>Middle East>MG RX5>Auto scan>EMS (Engine Management System)>Live data

Odometer Reading: 47052 km
License Plate: --
Sub Model: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.81

Serial Number: VA9GR4C01193



Engine: 94%