



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **COROLLA**

Date : **9/7/2026**

Plate No. : **956016**

Time : **14:15**

Model : **2023** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN: RKLBB0BE2P0045725

72035KM

Scratches + dents on body + plastic kit damage

Front left door bend + front bumper loose & broken

Lower cover damage + gearbox crankcase open before

Thank you for choosing Golden Munich cars inspection

Paint:

Plastic kit + rear right door

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

03/2019-04/2023 Toyota Vehicle Diagnostic Report

Vehicle Information

03//Toyota/Corolla/–
VIN: RKLBB0BE2P0045725

Odometer Reading: 78208 km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V7.43

Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260709135816583

System Scanned (17)

System		Status/DTC
Engine and ECT		2
Brake/EPB		2
SRS airbag		0
Combination meter		1
Tire pressure monitor		0
Main body		1
Master switch		0
Driver door motor		0
Right rear door motor		1
Left rear door motor		0
Passenger door motor		0
Air conditioner		0
Navigation system		1
Cruise control		0
EMPS		1
Steering angle sensor (SAS)		0
Central gateway		0

DTC (9)

Engine and ECT (2 DTCs)

DTC	Description	Status
-----	-------------	--------

P1605	Rough idling	Current
P1605	Rough idling	History

Brake/EPB (2 DTCs)

DTC	Description	Status
C137BA2	Brake system control module "A" system voltage system voltage low	Confirmed
C14FE14	Steering angle sensor supply voltage circuit short to ground or open	Confirmed

Combination meter (1 DTC)

DTC	Description	Status
U012987	Lost communication with brake system control module missing message	Confirmed

Main body (1 DTC)

DTC	Description	Status
B1247	Tire pressure monitor electronic control unit(ECU) lost communication	History

Right rear door motor (1 DTC)

DTC	Description	Status
B2312	Power window switch of right rear door fault	History

Navigation system (1 DTC)

DTC	Description	Status
B15C3	Speaker output circuit short	History

EMPS (1 DTC)

DTC	Description	Status
U012987	Lost communication with brake system control module missing message	Confirmed

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

03/2019-04/2023 Toyota Vehicle Diagnostic Report

Vehicle Information

03/2019-04/2023/Toyota/Corolla
VIN: RKLBB0BE2P0045725
Path: Toyota>Automatic
selection>Corolla>Europe/Others>ZRE>Taiwan, China
Product>03/2019-04/2023>Others>With smart key>With Electrical
Park Brake>Auto scan>Engine and ECT>Live data

Odometer Reading: 78208 km
License Plate: --
Sub Model: --

Customer Information


Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V7.43

Serial Number: VA9GR4C01193

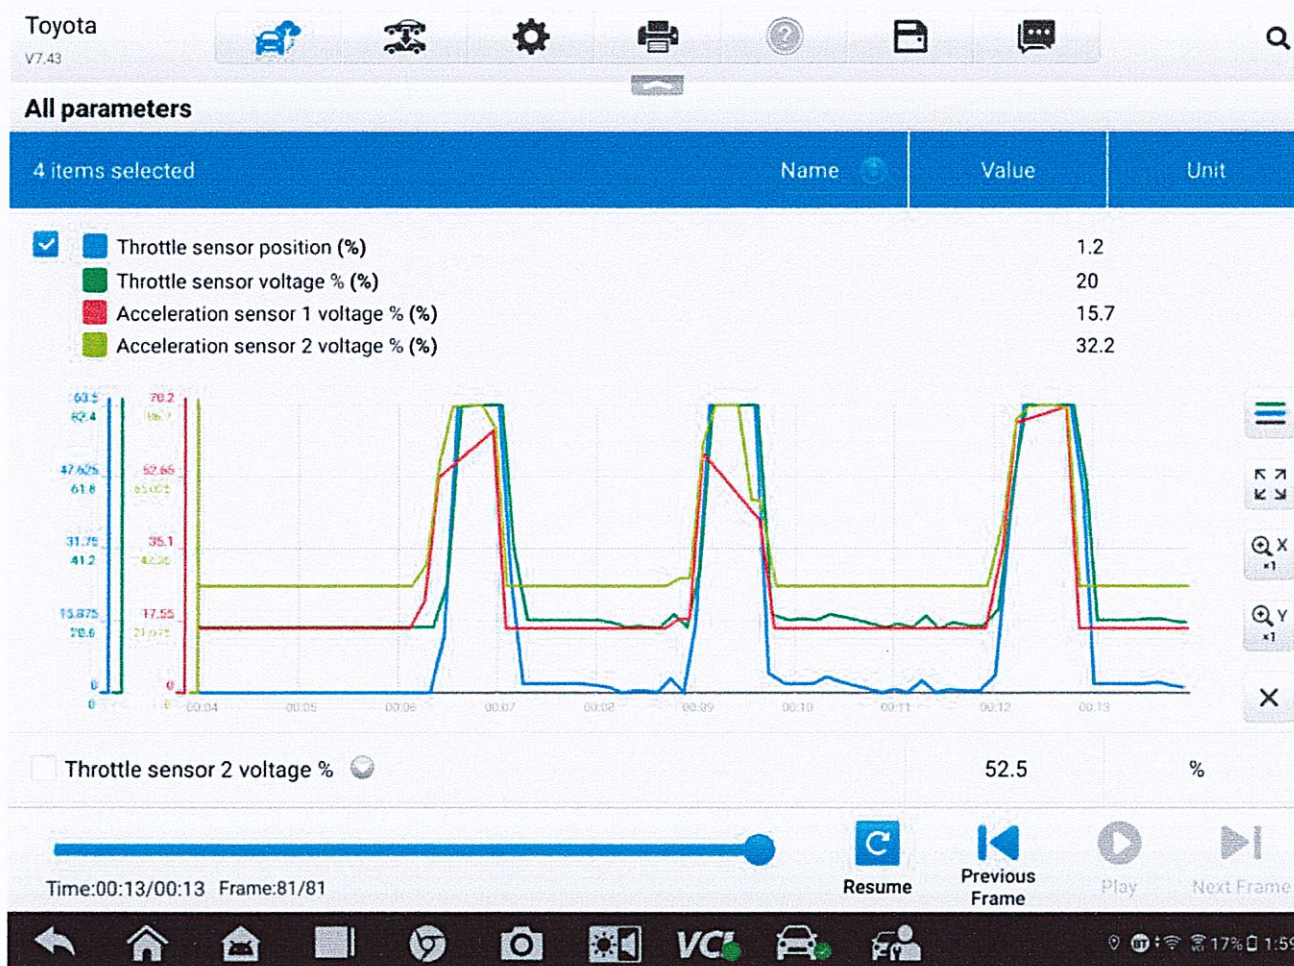

Engine 92 %