



ميوّنخ الذهبى لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة

Computerized Testing For All Kind of Cars



Car : **MG5**

Date : **9/7/2026**

Plate No. : **573013**

Time : **12:30**

Model : **2022** Color : **SILVER**

Type of Check : **Engine +gear+chassis+paint**

VIN: LSJA36E33NZ163759

126624KM

Scratches + dents on body + under the car scratches by stones

Service brake + service for gearbox + computer codes

Thank you for choosing Golden Munich cars inspection

Paint :

Plastic kit + rear right fender corner

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميوّنخ الذهبى لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

Saicmg Vehicle Diagnostic Report

Vehicle Information

--/Saicmg/China/MG5(2021)/
VIN: LSJA36E33NZ163759

Odometer Reading: 126624km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.81

Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260709121341837

System Scanned (7)

System	Status/DTC
EMS (Engine Management System)-EMS (Engine Management System)	15
TCM (Transmission Control Module)-TCM (Transmission Control Module)	2
ABS (Antilock Brake System) / SCS (Stability Control System)-SCS/ABS	0
SDM (Sensing Diagnostic Module)	0
IPK (Instrument Pack)	0
BCM (Body Control Module)	4
EPS (Electric Power Steering)-EPS (Electric Power Steering)	0

DTC (21)

EMS (Engine Management System)-EMS (Engine Management System) (15 DTCs)

DTC	Description	Status
P013326	Upstream oxygen sensor circuit slow response - sensor bilateral aging above upper limit	Aging
P0303F1	Misfire Detected-Cylinder 3-Misfire Rate That Deteriorate Emission	Aging
P0303F0	Misfire Detected-Cylinder 3-Misfire Rate That Harmful to Catalyst	Aging
P0304F1	Misfire Detected-Cylinder 4-Misfire Rate That Deteriorate Emission	Aging
P0304F0	Misfire Detected-Cylinder 4-Misfire Rate That Harmful to Catalyst	Aging

P0304F2	Misfire Detected-Cylinder 4-Implausible Fault	Aging
P0302F1	Misfire Detected-Cylinder 2-Misfire Rate That Deteriorate Emission	Aging
P0302F0	Misfire Detected-Cylinder 2-Misfire Rate That Harmful to Catalyst	Aging
P0301F0	Misfire Detected-Cylinder 1-Misfire Rate That Harmful to Catalyst	Aging
P0300F1	Misfire Detected-Random Or Multiple Cylinder-Misfire Rate That Deteriorate Emission	Aging
P0300F0	Misfire Detected-Random Or Multiple Cylinder-Misfire Rate That Harmful to Catalyst	Aging
P0300F2	Misfire Detected-Random Or Multiple Cylinder-Implausible Fault	Aging
P070000	Transmission Control Module (TCM) error - TCM requests MIL on	Intermittent
P002777	Exhaust Valve Control Circuit-Exhaust Camshaft Deadlock Position Operation Irrational	Aging
P161306	Immobiliser Status-Authenticaiton Challenge Period Expired	Aging

TCM (Transmission Control Module)-TCM (Transmission Control Module) (2 DTCs)

DTC	Description	Status
P185598	The engine stalls while the vehicle is driving at high speed	Aging
P278398	Hydraulic Torque Converter Clutch (TCC) over slip	Aging

BCM (Body Control Module) (4 DTCs)

DTC	Description	Status
U010187	Lost communication with Transmission Control Module (TCM)	Aging
U100887	Lost communication with Remote PRND Display Module (RPD)	Currently
B106673	Brake Pedal Switch Stuck	Intermittent
B107715	Main Light Switch Circuit Short to Battery or Open	Aging

Technician Notes

Saicmg Vehicle Diagnostic Report

Vehicle Information

Saicmg/China/MG5(2021)
VIN: LSJA36E33NZ163759
Path: Saicmg>Automatic selection>Auto scan>EMS (Engine Management System)>Live data

Odometer Reading: 126624 km
License Plate: --
Sub Model: --

Customer Information


Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.81

Serial Number: VA9GR4C01193

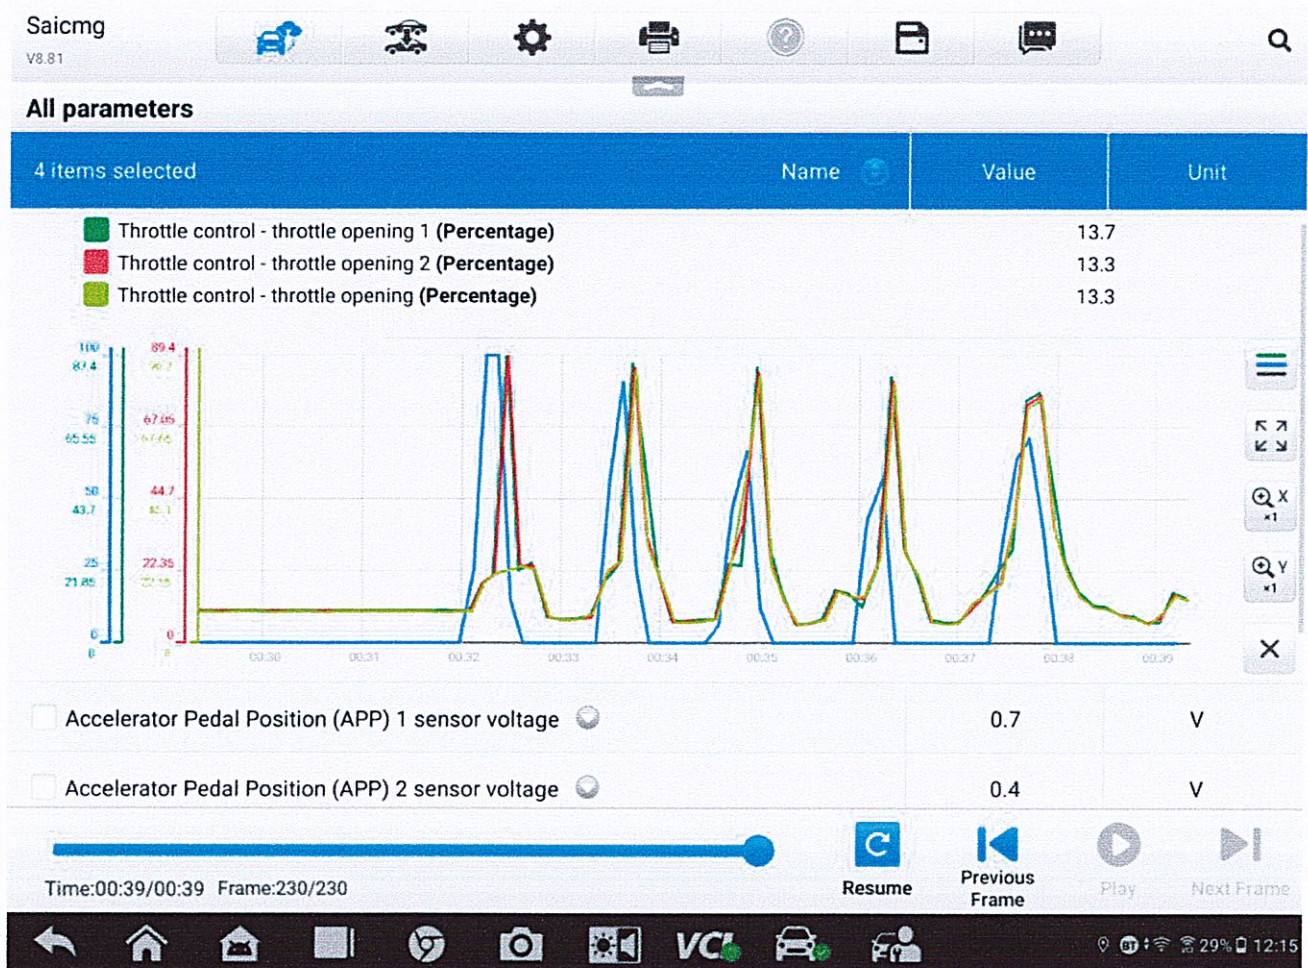

Engine: 87%