



ميونخ الذهبى لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **MG 5**

Date : **8/7/2026**

Plate No. : **215417**

Time : **14:57**

Model : **2022** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN: LSJA36E35NZ176299

57249KM

Scratches + dents on body + plastic kit + body paint damage

Rear bumper light loose + lower right body panel bend

Tune up engine + change engine oil + breather hose leak

Sound from steering box + service for gearbox

Thank you for choosing Golden Munich cars inspection

Piant:

Plastic kit + 1/4 lower right body panel

Front fender + rear door + rear fender right side

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبى لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة موآتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

Saicmg Vehicle Diagnostic Report

Vehicle Information

-/Saicmg/China/MG5(2021)/
VIN: LSJA36E35NZ176299Odometer Reading: 57249km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.81Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260708144942360

System Scanned (7)

System	Status/DTC
EMS (Engine Management System)-EMS (Engine Management System)	 1
TCM (Transmission Control Module)-TCM (Transmission Control Module)	 0
ABS (Antilock Brake System) / SCS (Stability Control System)-SCS/ABS	 0
SDM (Sensing Diagnostic Module)	 0
IPK (Instrument Pack)	 0
BCM (Body Control Module)	 1
EPS (Electric Power Steering)-EPS (Electric Power Steering)	 0

DTC (2)

EMS (Engine Management System)-EMS (Engine Management System) (1 DTC)

DTC	Description	Status
P013326	Upstream oxygen sensor circuit slow response - sensor bilateral aging above upper limit	Aging

BCM (Body Control Module) (1 DTC)

DTC	Description	Status
B106673	Brake Pedal Switch Stuck	Intermittent

Technician Notes

Saicmg Vehicle Diagnostic Report

Vehicle Information

Saicmg/China/MG5(2021)
VIN: LSJA36E35NZ176299
Path: Saicmg>Automatic selection>Auto scan>EMS (Engine Management System)>Live data


Odometer Reading: 57249 km
License Plate: --
Sub Model: --

Customer Information

Name: -- Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.81
Serial Number: VA9GR4C01193

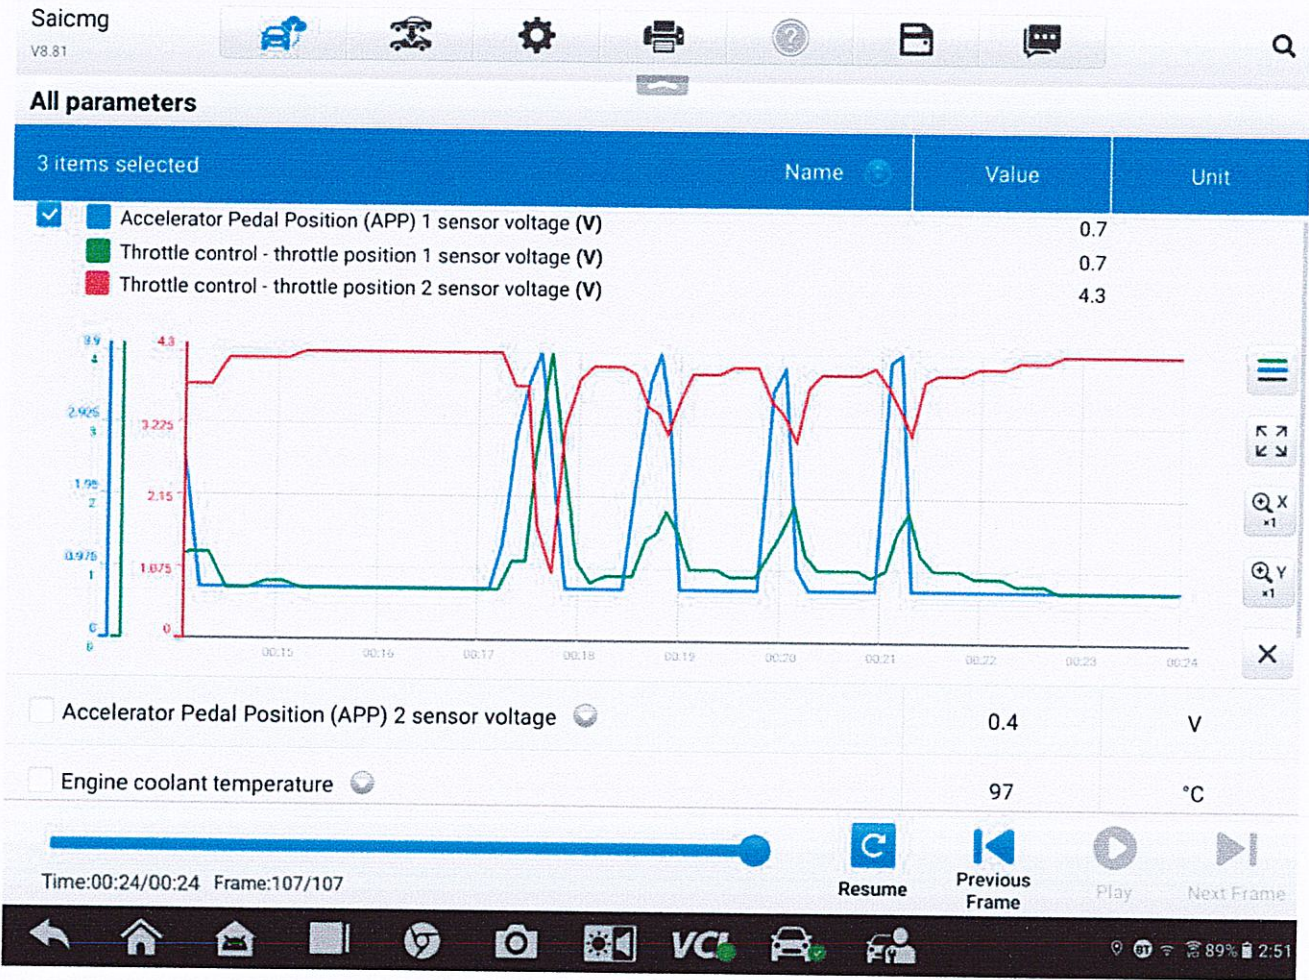

Engine R.L.