



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة

Computerized Testing For All Kind of Cars



Car : **CR-V**

Date : **15/8/2026**

Plate No. :

Time : **13:06**

Model : **2022** Color : **BLUE**

Type of Check : **Engine +gear+chassis+paint**

VIN: 5J6RW6853NL700636

57838KM

Scratches + dents on body + plastic kit + body paint damage

Rims scratched + front left fender kit loose + front right door bend

Front bumper broken + timing gasket leak + change brake pads

Thank you for choosing Golden Munich cars inspection

Paint:

Front bumper

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

2022 Honda Vehicle Diagnostic Report

Vehicle Information

2022/Honda/CR-V/
VIN: 5J6RW6853NL700636

Odometer Reading: 57838Km
License Plate: --

Customer Information

Name: --

Tel: --


Device Information

Scanner: MaxiSys MS909EV
Version: V7.32

Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260815083415171

System Scanned (13)

Topology

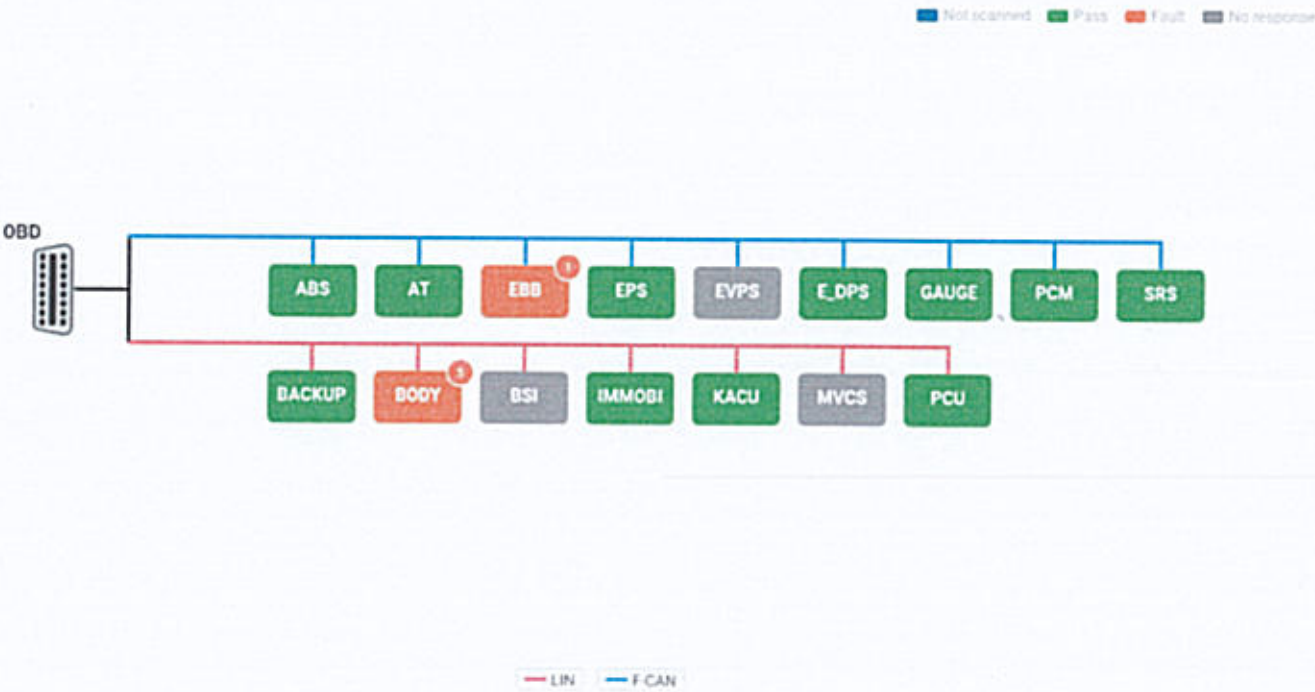

System	Status/DTC
PGM-FI	0
AT	0
ABS/VSA	0
SRS/SWS/PUH	0
Gauges	0
Body Electrical	5
Electric Brake Booster	1

ADAS

EPS	✓ 0
Power Control Unit	✓ 0
Backup Control Unit	✓ 0
Keyless access Control Unit	✓ 0
IMMOBI	✓ 0
Real Time AWD/AWD with Intelligent Control	✓ 0

DTC (6)

Body Electrical (5 DTCs)

DTC	Description	Status
B1385	Power Tailgate temperature sensor malfunction	Confirmed DTCs
U0199	Lost communication with P/W (DRLOCKSW,KLDRLOCK frame)	Confirmed DTCs
U1280	Communication Bus line Error(a bus OFF state is detected by Power Tail Gate ECU)	Confirmed DTCs
U1281	Lost communication with MICU (MICU frame)	Confirmed DTCs
U128D	Power Tailgate Control Unit lost communication with gauge Control Module	Confirmed DTCs

Electric Brake Booster (1 DTC)

DTC	Description	Status
U3003-16	Brake Booster Control Unit Power Circuit (+B) Low Voltage	Confirmed DTCs

I/M readiness status

Fault codes	Status
MIL status	OFF
DTC	0

Monitor status	Status
----------------	--------

	MIS	Misfire monitoring	⊘
	FUEL	Fuel system monitoring	⊘
	CCM	Comprehensive component monitoring	✓
	CAT	Catalyst monitoring	⊘
	HCAT	Heated catalyst monitoring	⊘
	EVAP	Evaporative system monitoring	⊘

2022 Honda Vehicle Diagnostic Report

Vehicle Information

2022/Honda/CR-V
VIN: 5J6RW6853NL700636
Path: Honda>Automatic
selection>5J6RW6853NL700636>GENERAL>CR-V>2022>Auto
scan>PGM-FI>Live data

Odometer Reading: 57838 Km
License Plate: --
Sub Model: GENERAL

Customer Information


Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V7.32

Serial Number: VA9GR4C01193

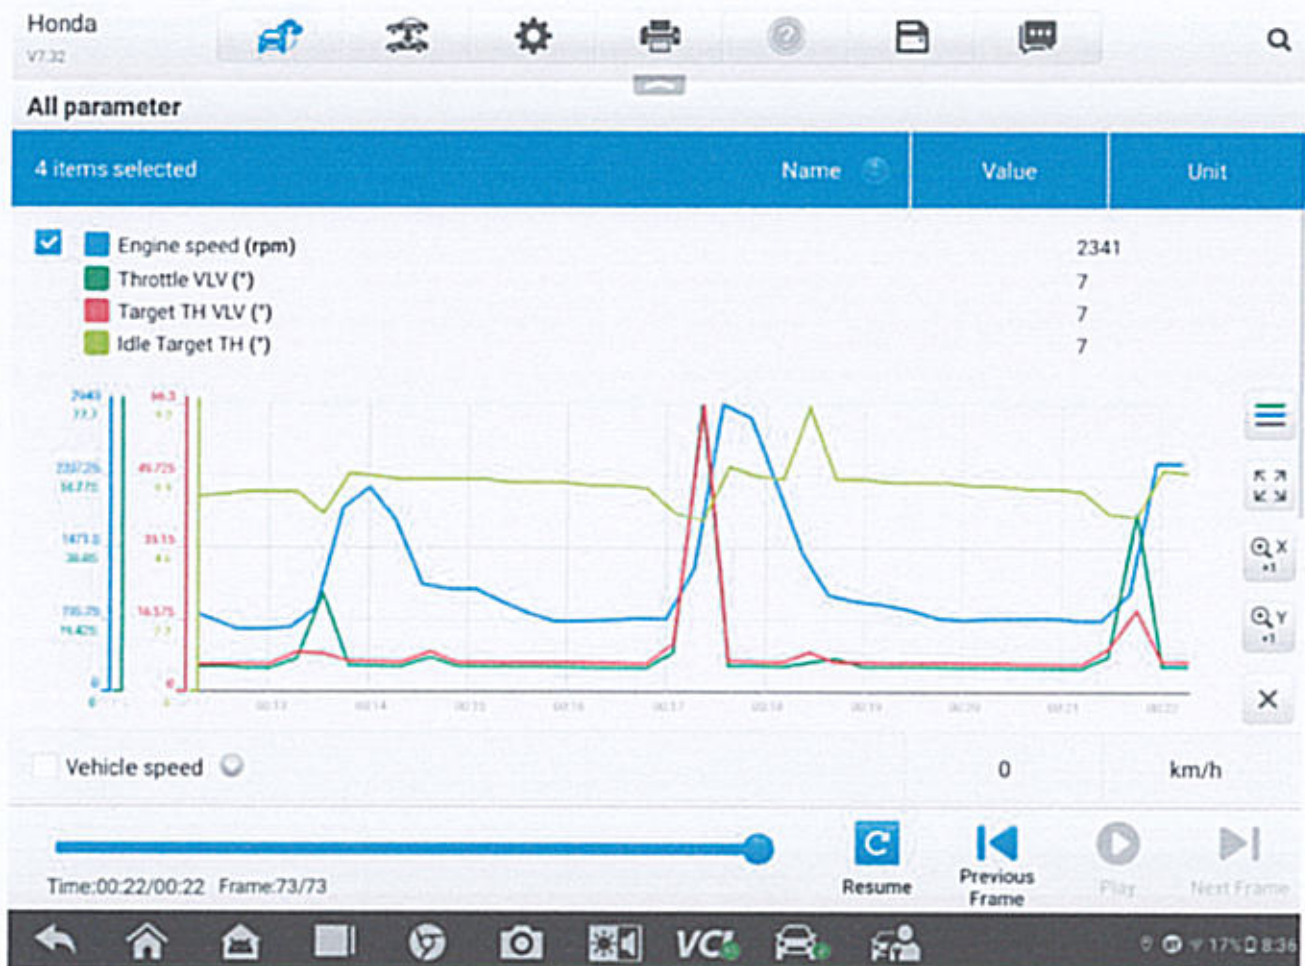

Engine 94/