



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة

Computerized Testing For All Kind of Cars



Car : **MG ZS**

Date : **15/8/2026**

Plate No. : **132602**

Time : **10:30**

Model : **2023** Color : **WHITE**

Type of Check : Engine +gear+chassis+paint

VIN: LSJW74U3XPZ083670

56724KM

Scratches + dents on body

Service for gearbox (make vibration) + service for computer codes

Service brake + tune up engine

Please check attached diagnosis computer report

Paint :

Plastic kit + 3/4 rear body door + front left fender

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

Saicmg Vehicle Diagnostic Report

Vehicle Information

-/Saicmg/China/NEW MG ZS(2020)/
VIN: LSJW74U3XPZ083670Odometer Reading: 56724km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.81Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260815103741811

System Scanned (8)

System	Status/DTC
EMS (Engine Management System)-EMS (Engine Management System)	 2
TCM (Transmission Control Module)-TCM (Transmission Control Module)	 1
ABS (Antilock Brake System) / SCS (Stability Control System)	 1
IPK (Instrument Pack)	 1
TPMS (Tyre Pressure Monitoring System)	 1
BCM (Body Control Module)	 6
ATC (Automatic Temperature Control)	 3
EPS (Electric Power Steering)	 3

DTC (18)

EMS (Engine Management System)-EMS (Engine Management System) (2 DTCs)

DTC	Description	Status
P002677	Intake valve control circuit - intake camshaft deadlock position operation implausible	Aging
P161306	Immobilizer status - no response received from immobilizer	Aging

TCM (Transmission Control Module)-TCM (Transmission Control Module) (1 DTC)

DTC	Description	Status
P185598	Engine off with high vehicle speed	Aging

ABS (Antilock Brake System) / SCS (Stability Control System) (1 DTC)

DTC	Description	Status
-----	-------------	--------

U156316	Battery Voltage Low	Aging
---------	---------------------	-------

IPK (Instrument Pack) (1 DTC)

DTC	Description	Status
U024587	Lost communication with Front Infotainment Control Module (FICM)	Aging

TPMS (Tyre Pressure Monitoring System) (1 DTC)

DTC	Description	Status
U156316	Battery Voltage Low	Intermittent

BCM (Body Control Module) (6 DTCs)

DTC	Description	Status
U156316	Battery Voltage Low	Aging
U024587	Lost communication with Front Infotainment Control Module (FICM)	Aging
U150000	VIN mismatch with Body Control Module (BCM) or instrument pack (IPK)	Aging
B104B13	Right turn lamp drive circuit open	Aging
B106673	Brake pedal switch stuck	Intermittent
U012787	Lost communication with TPMS	Intermittent

ATC (Automatic Temperature Control) (3 DTCs)

DTC	Description	Status
U156316	Battery Voltage Low	Aging
U024587	Lost communication with Front Infotainment Control Module (FICM)	Aging
U010087	Lost communication with ECM	Intermittent

EPS (Electric Power Steering) (3 DTCs)

DTC	Description	Status
U200142	ECU fault - EEPROM fault	Aging
C16B587	Electric Power Steering (EPS) steering performance mode cannot be changed due to steering customization setting request signal unavailable	Aging
U024587	Lost communication with Front Infotainment Control Module (FICM)	Aging

Technician Notes

Saicmg Vehicle Diagnostic Report

Vehicle Information

Saicmg/China/NEW MG ZS(2020)
VIN: LSJW74U3XPZ083670
Path: Saicmg>Automatic selection>Auto scan>EMS (Engine Management System)>Live data

Odometer Reading: 56724 km
License Plate: -
Sub Model: -

Customer Information


Name: -

Tel: -

Device Information

Scanner: MaxiSys MS909EV
Version: V8.81

Serial Number: VA9GR4C01193

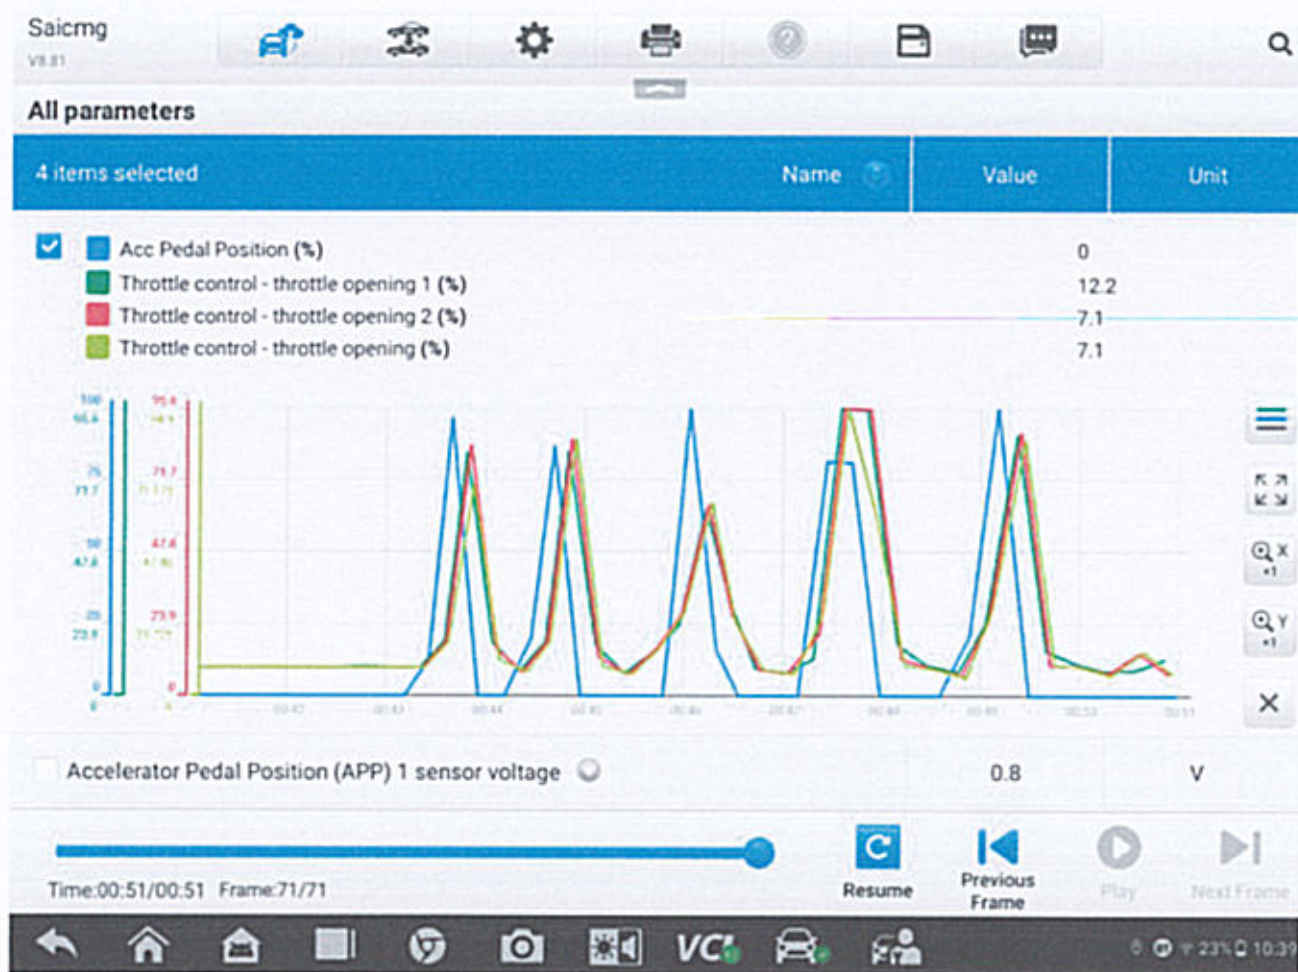

Engine: 93%