



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **EMGRAND**

Date : **15/8/2026**

Plate No. : **911045**

Time : **12:00**

Model : **2024** Color : **WHITE**

Type of Check : Engine +gear+chassis+paint

VIN: LB3F31S22RG015969

88475KM

Scratches + dents on body + rear right fender repaired

Timing gasket leak + service brake

Please check attached diagnosis computer report

Paint :

Front bumper + all right side

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواثر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

Geely Vehicle Diagnostic Report

Vehicle Information

--/Geely/Emgrand L/Emgrand L/
VIN: LB3F31S22RG015969

Odometer Reading: 88475km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V10.80

Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260815121901006

System Scanned (11)

System	Status/DTC
EMS (Engine Management System)	0
TCU (Transmission Control Unit)	3
ESP(Electronic Stability Program)	2
SRS (Supplement Restrain System)	1
IPK (Instrument panel system)	5
GW (Gateway)	1
EPS(Electronic Power Steering system)	1
TCM (Top Column Module)	0
BCM (Body Control Module)	0
A/C (automatic air conditioning system)	2
MMI(Multimedia system)	0

DTC (15)

TCU (Transmission Control Unit) (3 DTCs)

DTC	Description	Status
U300616	System voltage too low	Read Codes/History
P176100	ABS function failure	Read Codes/History
U015587	Lost Communication With GW_IPK	Read Codes/History

ESP(Electronic Stability Program) (2 DTCs)

DTC	Description	Status
C100004	ECU error (hardware, Micro-controller error)	Read Codes/History
U300616	ECU supply voltage low	Read Codes/History

SRS (Supplement Restrain System) (1 DTC)

DTC	Description	Status
U300616	Control unit input voltage low	Read Codes/History

IPK (Instrument panel system) (5 DTCs)

DTC	Description	Status
U300616	ECU supply voltage low	Read Codes/History
U014687	Lost communication with instrument VCU	Read Codes/History
U016487	AC message lost	Read Codes/History
U021487	Lost communication with passive entry & passive start system	Read Codes/History
U015687	Lost communication with multimedia interactive system	Read Codes/History

GW (Gateway) (1 DTC)

DTC	Description	Status
U300616	Control Module Input Power Low	Read Codes/History

EPS(Electronic Power Steering system) (1 DTC)

DTC	Description	Status
U300616	ECU controller power supply voltage low	Read Codes/History

A/C (automatic air conditioning system) (2 DTCs)

DTC	Description	Status
U300616	Controller input power voltage too low	Read Codes/History
B118371	air distribution motor is locked	Read Codes/History

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

Geely Vehicle Diagnostic Report

Vehicle Information

Geely/Emgrand L/Emgrand L

VIN: LB3F31S22RG015969

Path: Geely>Manual selection>Emgrand L>Emgrand L>Auto scan>EMS (Engine Management System)>Live data

Odometer Reading: 88475 km

License Plate: --

Sub Model: --

Customer Information

Name: --


Tel: --

Device Information

Scanner: MaxiSys MS909EV

Version: V10.80

Serial Number: VA9GR4C01193

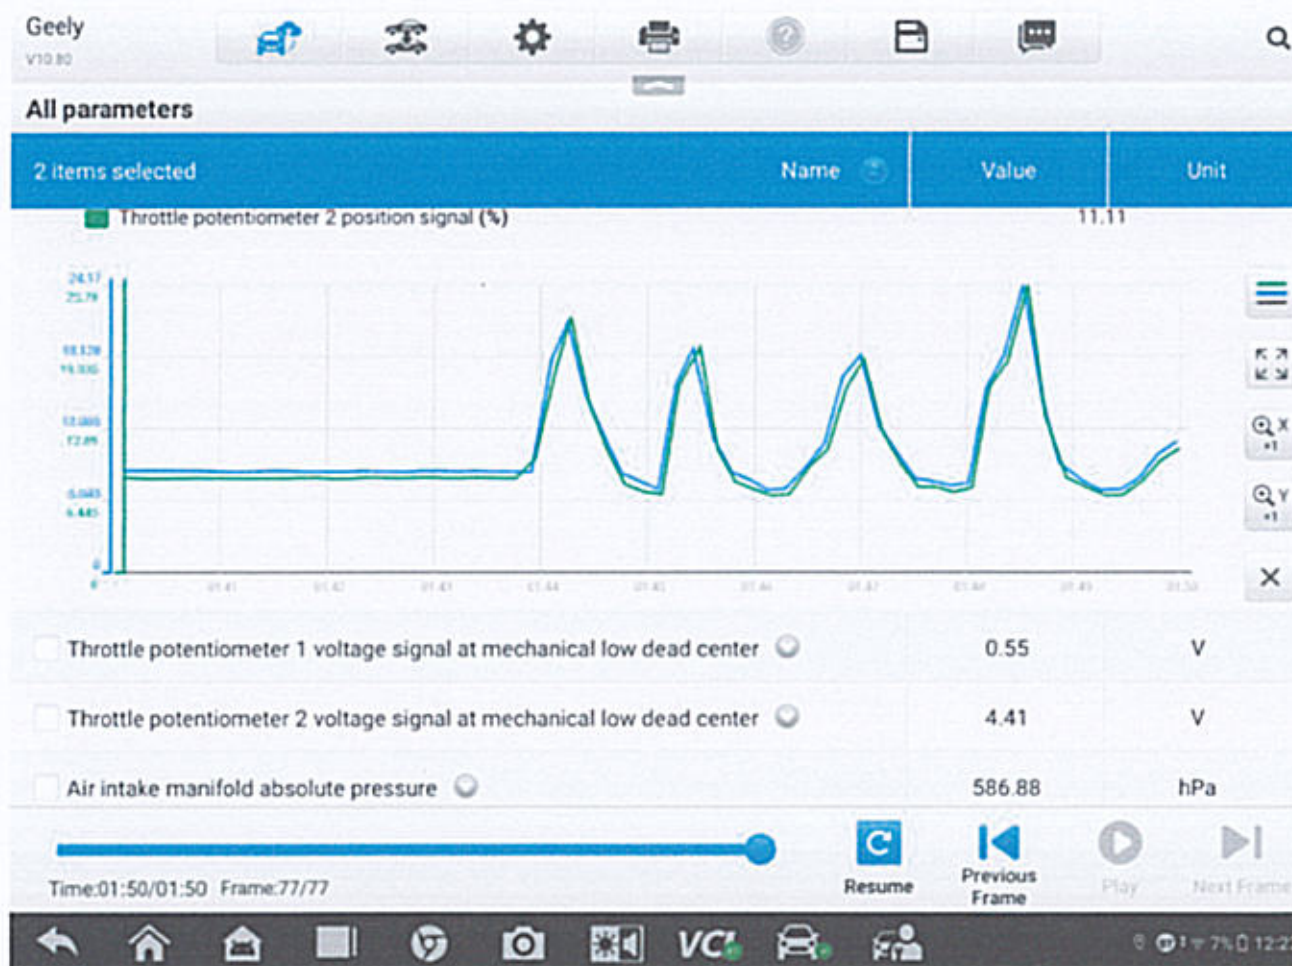

Engine: 90%.