



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : MG5	Date : 12/9/2026
Plate No. : 881276	Time : 10:00
Model : 2022 Color : WHITE	Type of Check : Engine +gear+chassis+paint

VIN: LSJA36E30NZ176968

112811KM

Change tyres + alignment

Scratches + dents on body + roof kit missing

Front mud flap broken + rear 2 fender & lower right body panel repaired

Cover under the car broken + under the car scratches by stones

Front iron bumper bolts open before + rear bumper support bend

AC compressor make sound + change brake pads + service for TCS

Service for front & rear overhaul suspension + tune up engine

Please check attached diagnosis computer report

Paint :

Plastic kit + 1/2 rear body door + lower right body panel

Front right door + rear right door + rear right fender

All left side

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده
* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة موآتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

Saicmg Vehicle Diagnostic Report

Vehicle Information

--/Saicmg/China/MG5(2021)/
VIN: LSJA36E30NZ176968

Odometer Reading: 112811km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.82

Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260912094655109

System Scanned (7)

System	Status/DTC
EMS (Engine Management System)-EMS (Engine Management System)	 9
TCM (Transmission Control Module)-TCM (Transmission Control Module)	 2
ABS (Antilock Brake System) / SCS (Stability Control System)-SCS/ABS	 2
SDM (Sensing Diagnostic Module)	 0
IPK (Instrument Pack)	 2
BCM (Body Control Module)	 7
EPS (Electric Power Steering)-EPS (Electric Power Steering)	 1

DTC (23)

EMS (Engine Management System)-EMS (Engine Management System) (9 DTCs)

DTC	Description	Status
P05041C	Brake switch signal A/B consistency - brake light signal fault	Aging
P057824	Cruise control multi-function input A circuit stuck	Aging
P070000	Transmission Control Module (TCM) error - TCM requests MIL on	Aging
P002777	Exhaust Valve Control Circuit-Exhaust Camshaft Deadlock Position Operation Irrational	Aging
P002677	Intake Valve Control Circuit-Intake Camshaft Deadlock Position Operation Irrational	Aging

P085212	Neutral switch signal inconsistent with CAN signal - N/P engaged displayed by CAN, N/P not engaged displayed by sensor	Aging
P061611	Starter relay control circuit short to ground (high side)	Aging
P031881	Rough road detection acceleration sensor signal fault	Aging
P05601C	System battery voltage signal implausible	Aging

TCM (Transmission Control Module)-TCM (Transmission Control Module) (2 DTCs)

DTC	Description	Status
U18F981	CAN frame invalid	Aging
U156316	Module supply voltage below threshold	Aging

ABS (Antilock Brake System) / SCS (Stability Control System)-SCS/ABS (2 DTCs)

DTC	Description	Status
C005129	Steering Wheel Angle Not Initialized after Power-on Reset	Intermittent
U042881	Invalid Steering Wheel Angle Data Received	Intermittent

IPK (Instrument Pack) (2 DTCs)

DTC	Description	Status
U156316	Battery voltage too low	Aging
P058996	Cruise Control Multi-Function Input 'B'Circuit Component Internal Failure	Aging

BCM (Body Control Module) (7 DTCs)

DTC	Description	Status
U156316	Battery voltage too low	Aging
B1B0116	Low Battery Voltage (High Resolution Input)	Aging
U202147	ECU Error - External Watchdog Error	Aging
B104A13	Left turn signal light control circuit open	Aging
B104B13	Right turn signal light control circuit open	Aging
B106673	Brake Pedal Switch Stuck	Intermittent
B112A71	Drivers Door Window Switch Stuck Switch	Aging

EPS (Electric Power Steering)-EPS (Electric Power Steering) (1 DTC)

DTC	Description	Status
U041681	Invalid data received from dynamic Stability Control System (SCS)	Currently

Technician Notes

Saicmg Vehicle Diagnostic Report

Vehicle Information

Saicmg/China/MG5(2021)
 VIN: LSJA36E30NZ176968
 Path: Saicmg>Automatic selection>Auto scan>EMS (Engine Management System)>Live data


Odometer Reading: 112811 km
 License Plate: --
 Sub Model: --

Customer Information

Name: -- Tel: --

Device Information

Scanner: MaxiSys MS909EV
 Version: V8.82
 Serial Number: VA9GR4C01193

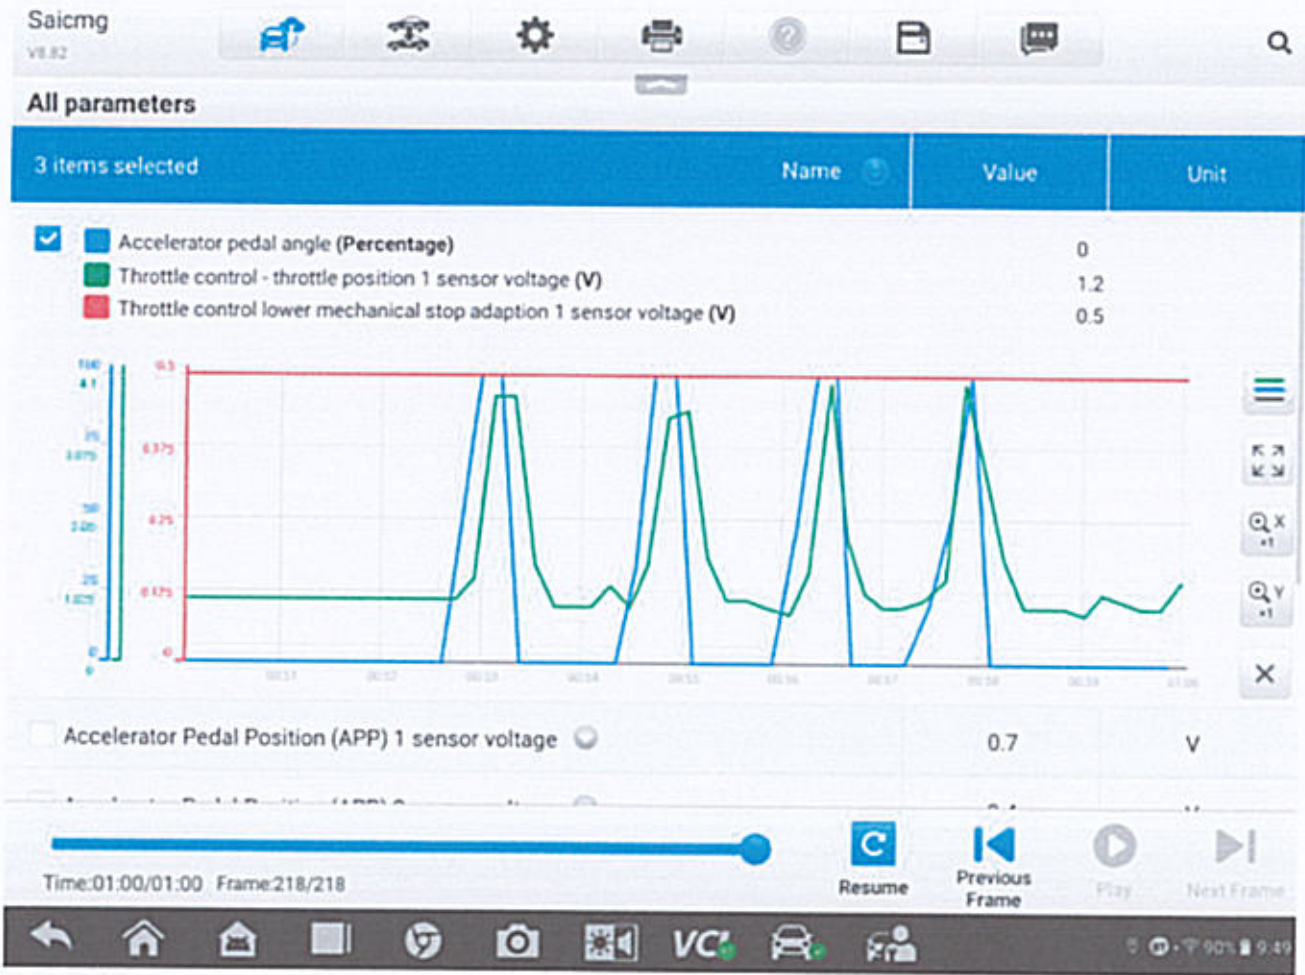

Engie: 88%