



# ميونخ الذهبي لفحص السيارات ذ.م.م

## Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة  
Computerized Testing For All Kind of Cars



Car : **MAXUS T60**

Date : **12/9/2026**

Plate No. : **167086**

Time : **11:00**

Model : **2025** Color : **WHITE**

Type of Check : Engine +gear+chassis+paint

**VIN: LSFAM11H7SA044344**

**16476KM**

Scratches + dents on body + front left door & rear left fender bend

Service for AC

Please check attached diagnosis computer report

**Paint :**

No paint on body

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

\* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

## 2025 MAXUS Vehicle Diagnostic Report

### Vehicle Information

2025/MAXUS/T60/XingJi L(D20)/  
VIN: LSFAM11H7SA044344Odometer Reading: 16476km  
License Plate: --

### Customer Information

Name: --

Tel: --

### Device Information

Scanner: MaxiSys MS909EV  
Version: V6.60Serial Number: VA9GR4C01193  
Repair Order Number:  
VA9GR4C0119320260912110808199

### System Scanned ( 7 )

| System                                                                     | Status/DTC |
|----------------------------------------------------------------------------|------------|
| EMS (Engine Management System)-Engine Management System (EMS) MT22 1 4G69  | 1          |
| ABS/ESP (ABS or electronic stability program)-Electronic stability program | 0          |
| SRS (Supplemental Restraint System)                                        | 1          |
| IC (Instrument Cluster)-Instrument Cluster (IC)                            | 3          |
| TPMS (Tire Pressure Monitor System)                                        | 2          |
| BCM (Body Control Module)-BCM (Body Control Module)                        | 0          |
| SAS (Steering Wheel Angle Sensor)                                          | 0          |



### DTC ( 7 )

#### EMS (Engine Management System)-Engine Management System (EMS) MT22 1 4G69 ( 1 DTC )

| DTC      | Description                              | Status                    |
|----------|------------------------------------------|---------------------------|
| P0616-00 | Immobilizer Key Not Programmed – ECM/PCM | DTC: history<br>Lamp: off |

#### SRS (Supplemental Restraint System) ( 1 DTC )

| DTC      | Description                          | Status                    |
|----------|--------------------------------------|---------------------------|
| U1000-16 | Main power supply voltage is too low | DTC: history<br>Lamp: off |

#### IC (Instrument Cluster)-Instrument Cluster (IC) ( 3 DTCs )

| DTC      | Description                                  | Status                    |
|----------|----------------------------------------------|---------------------------|
| B1117-16 | Lost communication with right rear door node | DTC: history<br>Lamp: off |

U0140-87 Lost communication with left Instrument Panel (IP) node

DTC: history  
Lamp: off

U0128-87 Left rear Instrument Panel (IP) node controller fault

DTC: history  
Lamp: off**TPMS (Tire Pressure Monitor System) ( 2 DTCs )**

| DTC      | Description          | Status                   |
|----------|----------------------|--------------------------|
| B100F-21 | FR Tire Low Pressure | DTC: pending<br>Lamp: on |
| B1010-21 | RR Tire Low Pressure | DTC: pending<br>Lamp: on |

**Technician Notes**

Customer name: \_\_\_\_\_

Technician: \_\_\_\_\_

Date: \_\_\_\_\_

Note: Please save a copy of this report for your records.

# 2025 MAXUS Vehicle Diagnostic Report

## Vehicle Information

2025/MAXUS/T60/XingJi L(D20)  
VIN: LSFAM11H7SA044344  
Path: MAXUS>Automatic selection>T60/XingJi L(D20)>Auto scan>Engine Management System (EMS) MT22 1 4G69>Live data

Odometer Reading: 16476 km  
License Plate: --  
Sub Model: --

## Customer Information


Name: --

Tel: --

## Device Information

Scanner: MaxiSys MS909EV  
Version: V6.60

Serial Number: VA9GR4C01193

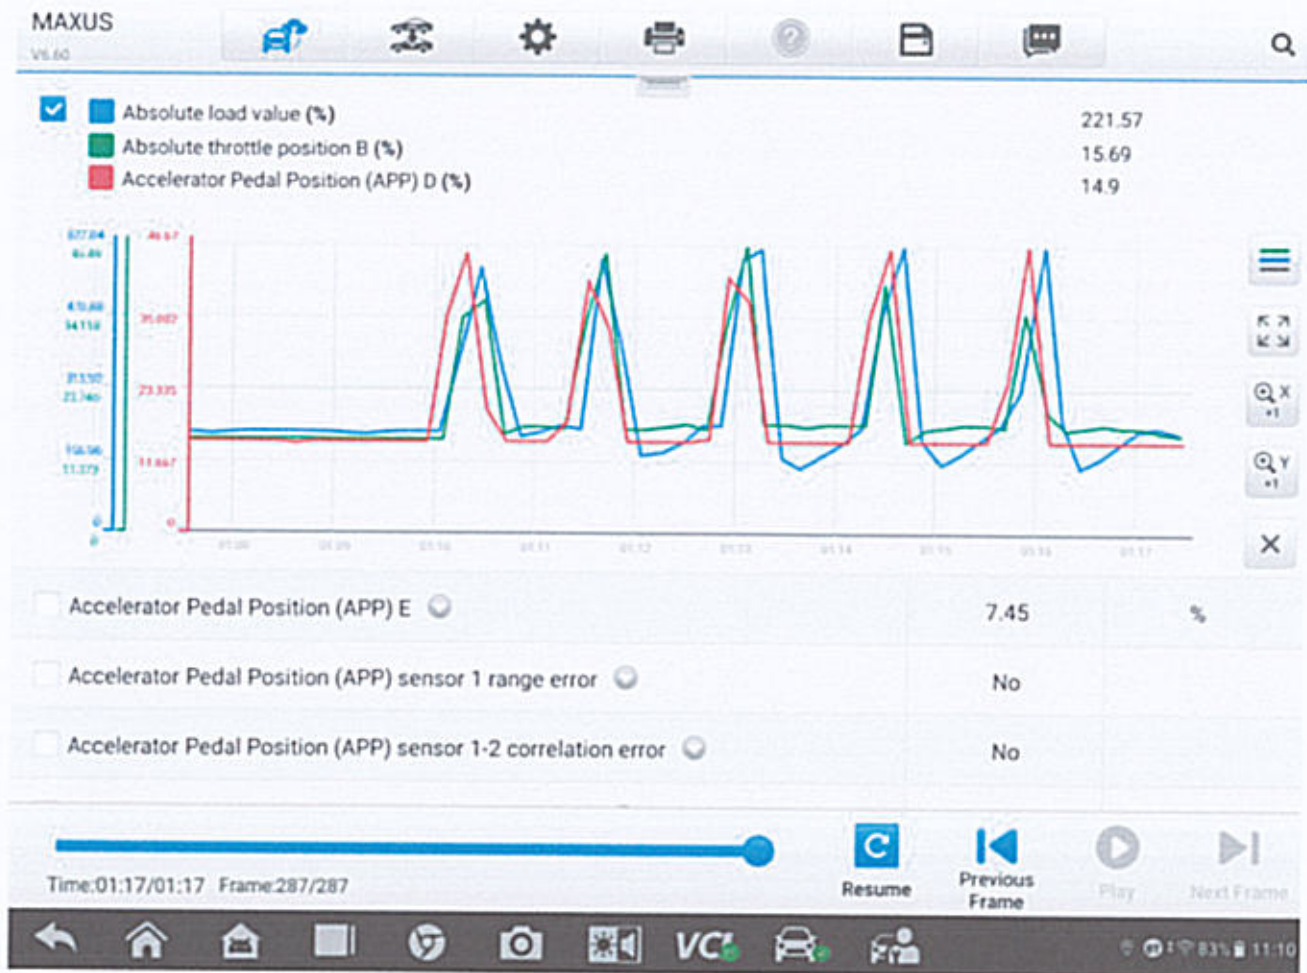

Engine: 94%