



ميونخ الذهبي لفحص السيارات ذ.م.م.

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **MG5**

Date : **12/9/2026**

Plate No. : **122607**

Time : **9:00**

Model : **2024** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN: LSJA36E3XRZ029045

170955KM

Change tyres + alignment

Scratches + dents on body

Rear iron bumper + rear iron bumper support bend

Service for front & rear overhaul suspension

Please check attached diagnosis computer report

Paint :

Plastic kit

1/2 front right fender + 1/4 rear right fender

3/4 rear left fender

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده
* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

Saicmg Vehicle Diagnostic Report

Vehicle Information

--/Saicmg/Middle East/MG5/2021-/
VIN: LSJA36E3XRZ029045

Odometer Reading: 170955km
License Plate: --

Customer Information

Name: --

Tel: --


Device Information

Scanner: MaxiSys MS909EV
Version: V8.82

Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260912084808891

System Scanned (6)

Topology

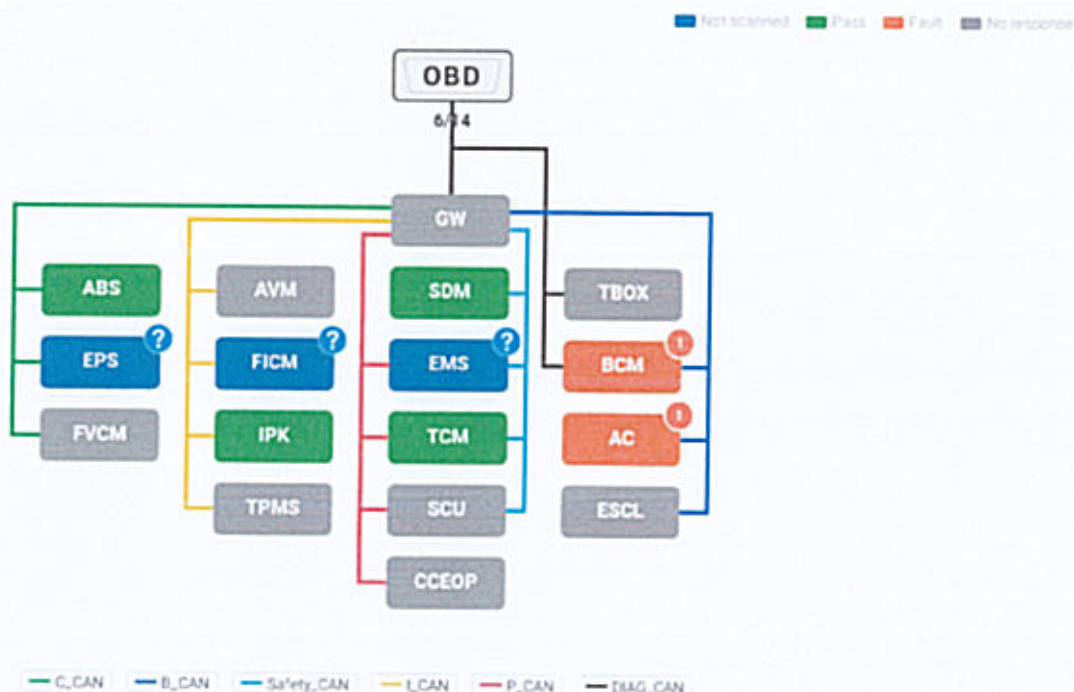

System

Status/DTC

TCM (Transmission Control Module)-TCM
(Transmission Control Module)

✓ 0

ABS (Antilock Brake System) / SCS (Stability Control
System)-SCS/ABS

✓ 0

SDM (Sensing Diagnostic Module)

✓ 0

IPK (Instrument Pack)

✓ 0

BCM (Body Control Module)

✗ 1

ATC (Automatic Temperature Control)

✗ 1

 DTC (2)**BCM (Body Control Module) (1 DTC)**

DTC	Description	Status
B106673	Brake Pedal Switch Stuck	Intermittent

ATC (Automatic Temperature Control) (1 DTC)

DTC	Description	Status
B14111C	Ambient Temperature Sensor Reading Out of Range	Aging

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

Saicmg Vehicle Diagnostic Report

Vehicle Information

Saicmg/Middle East/MG5/2021-
VIN: LSJA36E3XRZ029045
Path: Saicmg>Manual selection>Middle East>MG5>2021->Auto
scan>EMS (Engine Management System)>Trouble Codes

Odometer Reading: 170955 km
License Plate: --
Sub Model: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.82

Serial Number: VA9GR4C01193

Saicmg

V8.82

Saicmg > Manual selection > Auto scan > EMS (Engine Management System) > Trouble Codes

VCI 14.9V

Trouble Codes

Trouble codes are not detected.

VIN: LSJA36E3XRZ029045
Info: Saicmg Middle East MG5/2021-
SN: VA9GR4C01193

Remote Expert
Vehicle Data
Freeze frame
Erase codes
Read codes
Search
ESC

94% 8:49

Saicmg Vehicle Diagnostic Report

Vehicle Information

Saicmg/Middle East/MG5/2021-
VIN: LSJA36E3XRZ029045
Path: Saicmg>Manual selection>Middle East>MG5>2021->Auto scan>EMS (Engine Management System)>Live data


Odometer Reading: 170955 km
License Plate: --
Sub Model: --

Customer Information

Name: -- Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.82
Serial Number: VA9GR4C01193

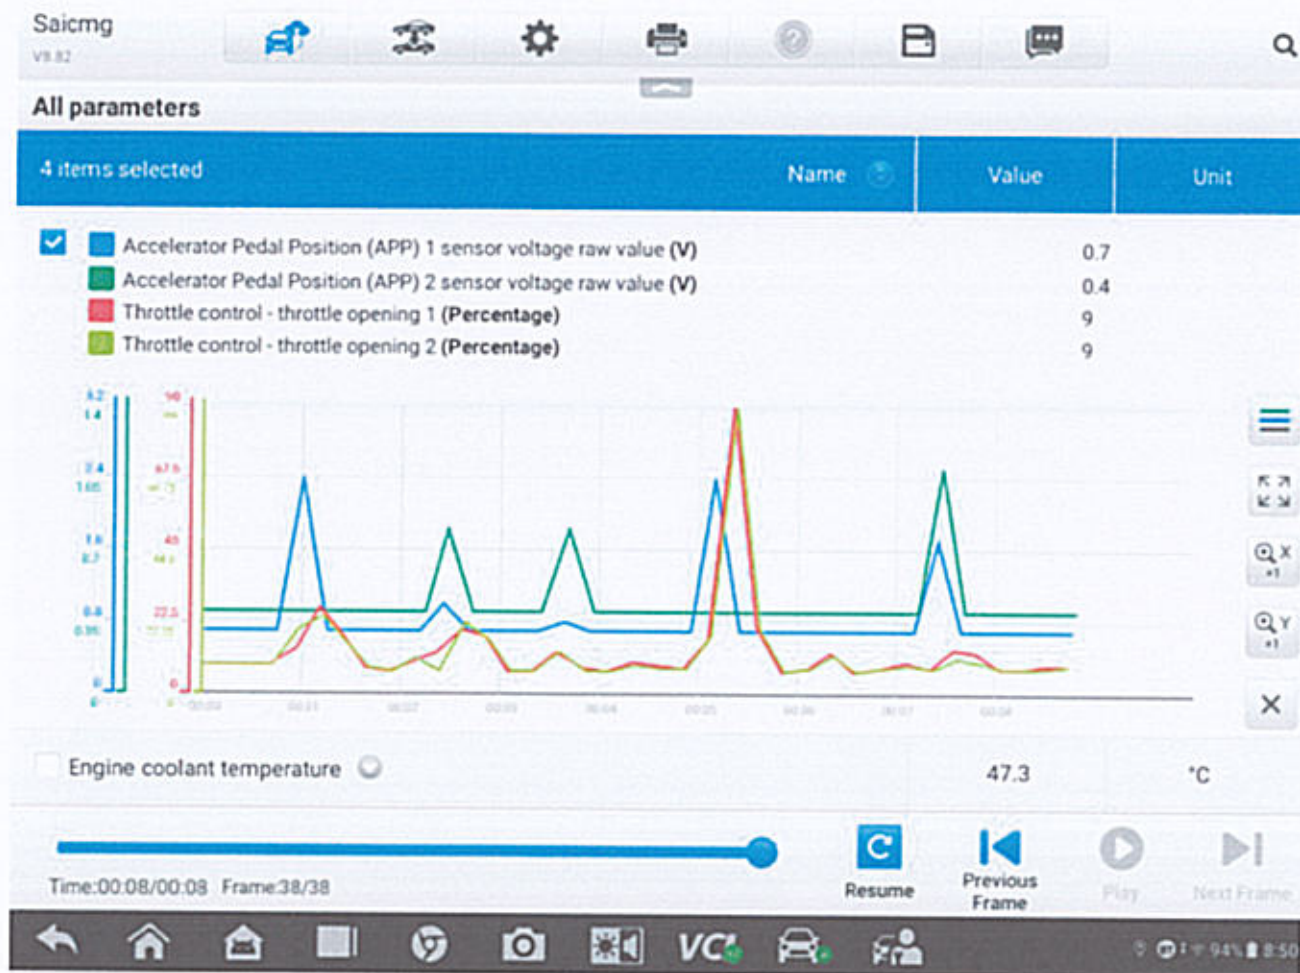

Engine : 85%