



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : MG5	Date : 12/9/2026
Plate No. : 881275	Time : 10:30
Model : 2022 Color : WHITE	Type of Check : Engine +gear+chassis+paint

VIN: LSJA36E37NK152957

121334KM

Scratches + dents on body + front left door linear bend

Rear left fender repaired + lower right panel bend

Lower cover broken + bolts between engine & gearbox open before

Valve sound on acceleration

Service brake + change front arm bushes

Please check attached diagnosis computer report

Paint:

Plastic kit + rear left fender

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخبسة - قطر

Customer Service

+974 40082021

خدمة العملاء

Saicmg Vehicle Diagnostic Report

Vehicle Information

--/Saicmg/China/MG5(2021)/
VIN: LSJA36E37NZ152957

Odometer Reading: 121334km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.82

Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260912103124575

System Scanned (7)

System	Status/DTC
EMS (Engine Management System)-EMS (Engine Management System)	 12
TCM (Transmission Control Module)-TCM (Transmission Control Module)	 1
ABS (Antilock Brake System) / SCS (Stability Control System)-SCS/ABS	 0
SDM (Sensing Diagnostic Module)	 0
IPK (Instrument Pack)	 1
BCM (Body Control Module)	 7
EPS (Electric Power Steering)-EPS (Electric Power Steering)	 0

DTC (21)

EMS (Engine Management System)-EMS (Engine Management System) (12 DTCs)

DTC	Description	Status
P057824	Cruise control multi-function input A circuit stuck	Aging
P013326	Upstream oxygen sensor circuit slow response - sensor bilateral aging above upper limit	Aging
P0303F1	Misfire Detected-Cylinder 3-Misfire Rate That Deteriorate Emission	Aging
P0303F0	Misfire Detected-Cylinder 3-Misfire Rate That Harmful to Catalyst	Aging
P0304F1	Misfire Detected-Cylinder 4-Misfire Rate That Deteriorate Emission	Aging

P0304F0	Misfire Detected-Cylinder 4-Misfire Rate That Harmful to Catalyst	Aging
P0302F1	Misfire Detected-Cylinder 2-Misfire Rate That Deteriorate Emission	Aging
P0301F0	Misfire Detected-Cylinder 1-Misfire Rate That Harmful to Catalyst	Aging
P0300F1	Misfire Detected-Random Or Multiple Cylinder-Misfire Rate That Deteriorate Emission	Aging
P0300F0	Misfire Detected-Random Or Multiple Cylinder-Misfire Rate That Harmful to Catalyst	Aging
P002777	Exhaust Valve Control Circuit-Exhaust Camshaft Deadlock Position Operation Irrational	Aging
P002677	Intake Valve Control Circuit-Intake Camshaft Deadlock Position Operation Irrational	Aging

TCM (Transmission Control Module)-TCM (Transmission Control Module) (1 DTC)

DTC	Description	Status
U156316	Module supply voltage below threshold	Aging

IPK (Instrument Pack) (1 DTC)

DTC	Description	Status
P095596	Auto Shift Manual Mode Circuit Component Internal Failure	Aging

BCM (Body Control Module) (7 DTCs)

DTC	Description	Status
U156316	Battery voltage too low	Aging
U202147	ECU Error - External Watchdog Error	Aging
B106673	Brake Pedal Switch Stuck	Intermittent
B107715	Main Light Switch Circuit Short to Battery or Open	Aging
B11091E	wiper delay out of range	Aging
B112A71	Drivers Door Window Switch Stuck Switch	Aging
C1A0331	No RF Signal Received from Right Front Tyre Sensor	Aging

Technician Notes

Saicmg Vehicle Diagnostic Report

Vehicle Information

Saicmg/China/MG5(2021)
VIN: LSJA36E37NZ152957
Path: Saicmg>Automatic selection>Auto scan>EMS (Engine Management System)>Live data

Odometer Reading: 121334 km
License Plate: --
Sub Model: --

Customer Information


Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V8.82

Serial Number: VA9GR4C01193

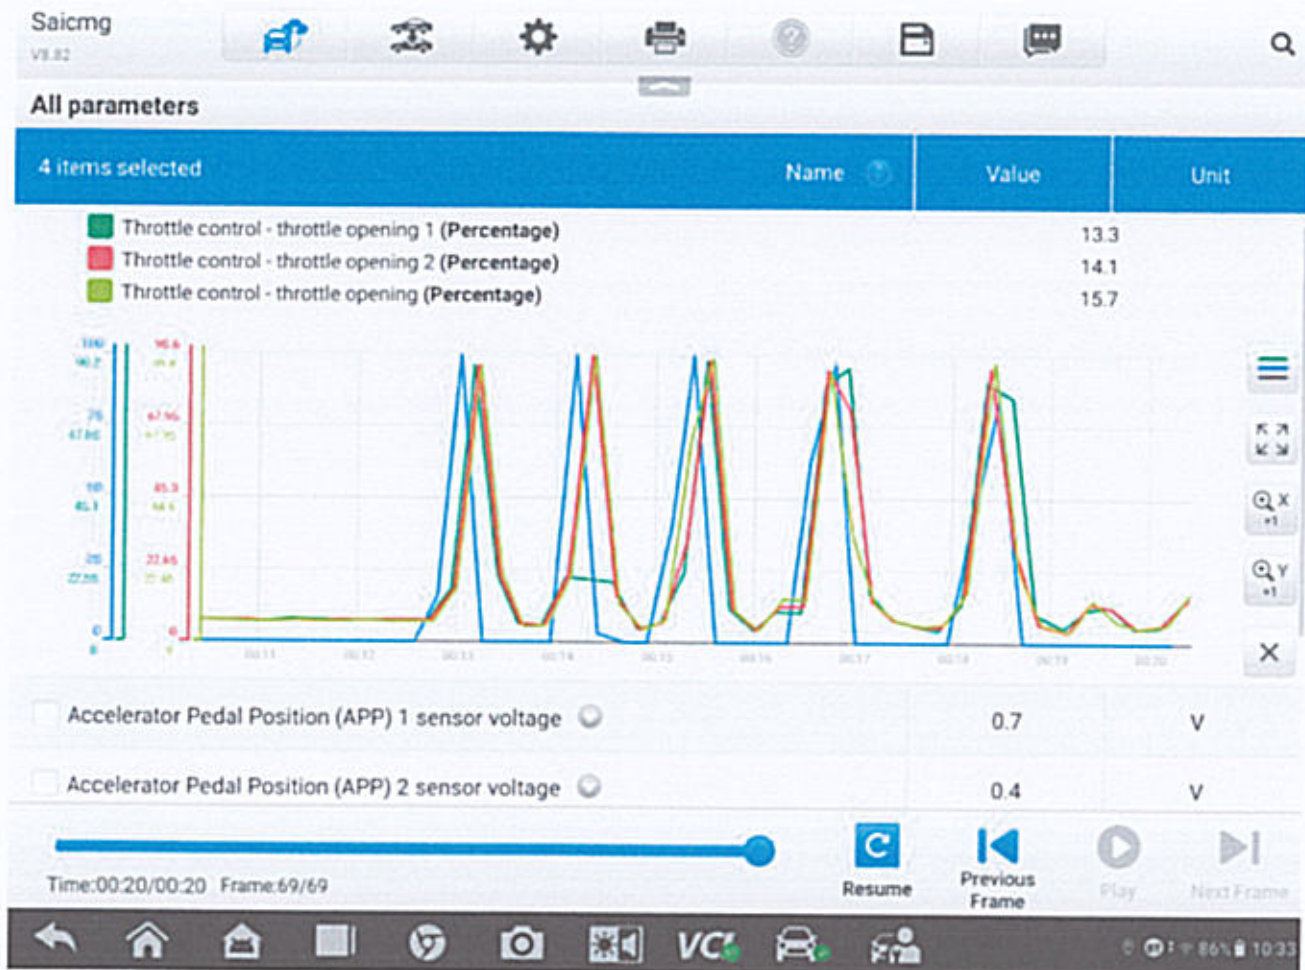

Engine 88%