



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **PEGAS**

Date : **9/7/2026**

Plate No. : **453861**

Time : **15:00**

Model : **2022** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN:LJD0AA294N0170768

148740KM

Scratches + dents on body + plastic kit + front left door bend

Front right fender bolts open before + front under fender bend

Lower cover broken + front bumper sensor loose

Front face support bend + scratches by stone under the car

Valve cover gasket + timing gasket + gearbox crankcase open before

Front axle boot leak + change brake pads

Thank you for choosing Golden Munich cars inspection

Paint:

Bonnet + 1/2 rear body door + 1/4 lower right panel

Front right door + front left fender

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء



Shop Name: --
Tel: --
Email: --
Address: --

Report ID: MAXIA20260709144919
Test Time: 2026-07-09 14:49:19
Technician: --

2022 Kia(Europe) Vehicle Diagnostic Report

Vehicle Information

2022/Kia(Europe)/Pegas/Soluto (AB)/G 1.4 MPI KAPPA
VIN: LJD0AA294N0170768

Odometer Reading: --
License Plate: --

Customer Information

Name: --
Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V9.23

Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260709144900727

System Scanned (10)

System	Status/DTC
ENG (Engine)	 0
A/T (Transaxle)	 0
ABS/ESC (Anti Lock Brake/Electronic Stability Control)	 0
AB (Airbag)	 0
CLU (Cluster Module)	 0
TPMS (Tire Pressure Monitoring System)	 0
BCM (Body Control)	 0
IMMO (Immobilizer)	 0
CODE (Transmitter Code Saving)	 0
EPS (Motor Driven Power Steering)	 0

DTC (0)

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

Disclaimer: This report provides a reference for vehicle inspection and maintenance only. Autel is not liable for any accident, property damage, or personal injury resulting from the use of this information.

2022 Kia Vehicle Diagnostic Report

Vehicle Information

2022/Kia/Pegas/Soluto (AB)/G 1.4 MPI KAPPA
 VIN: LJD0AA294N0170768
 Path: Kia>Automatic selection>Kia(Europe)>Pegas/Soluto (AB)>2022>G 1.4 MPI KAPPA>Auto scan>ENG (Engine)>Live data


Odometer Reading: --
 License Plate: --
 Sub Model: --

Customer Information

Name: -- Tel: --

Device Information

Scanner: MaxiSys MS909EV Serial Number: VA9GR4C01193
 Version: V9.23

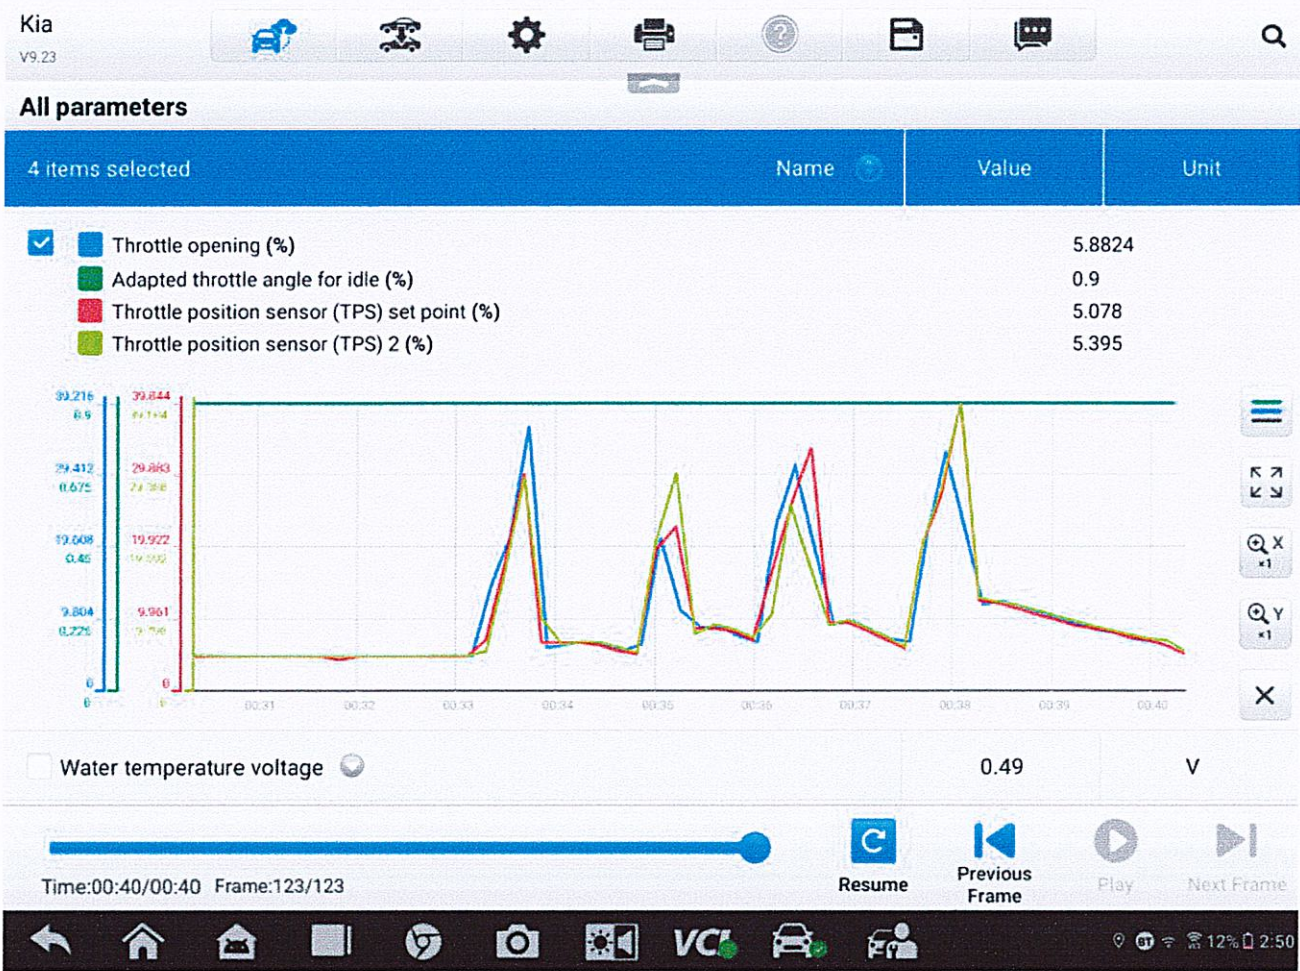

Engine 89%