



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **PEGAS**

Date : **9/7/2026**

Plate No. : **883283**

Time : **10:30**

Model : **2022** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN: LJD0AA291N0189021

127742KM

Change rear tyres

Scratches + dents on body + dashboard kit broken + roof dents

Roof paint damage by rust + front left fender bolts open before

Front & rear face bend + cover under the car broken

Under the car & chassis damage by stones

Front head chassis place of front face support small bend

Gearbox crankcase open before

Please check attached diagnosis computer report

Paint :

Plastic kit + bonnet + front right fender

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examonation or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar
Mawater City - Rawdat Rashed - Qatar
Al Kheesa Qatar
Customer Service

+974 66338337
+974 66332237
+974 66332237
+974 40082021

طريق سلوى - عين خالد - قطر
مدينة موآتر - روضة راشد - قطر
الخيصة - قطر
خدمة العملاء



Shop Name: --
Tel: --
Email: --
Address: --

Report ID: MAXIA20260709101110
Test Time: 2026-07-09 10:11:10
Technician: --

2022 Kia(Europe) Vehicle Diagnostic Report

Vehicle Information

2022/Kia(Europe)/Pegas/Soluto (AB)/G 1.4 MPI KAPPA
VIN: LJD0AA291N0189021

Odometer Reading: --
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V9.23

Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260709101050939



System Scanned (10)

System	Status/DTC
ENG (Engine)	✓ 0
A/T (Transaxle)	✓ 0
ABS/ESC (Anti Lock Brake/Electronic Stability Control)	✓ 0
AB (Airbag)	✓ 0
CLU (Cluster Module)	✓ 0
TPMS (Tire Pressure Monitoring System)	✓ 0
BCM (Body Control)	✓ 0
IMMO (Immobilizer)	✓ 0
CODE (Transmitter Code Saving)	✓ 0
EPS (Motor Driven Power Steering)	✓ 0



DTC (0)

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

Disclaimer: This report provides a reference for vehicle inspection and maintenance only. Autel is not liable for any accident, property damage, or personal injury resulting from the use of this information.



2022 Kia Vehicle Diagnostic Report

Vehicle Information

2022/Kia/Pegas/Soluto (AB)/G 1.4 MPI KAPPA
 VIN: LJD0AA291N0189021
 Path: Kia>Automatic selection>Kia(Europe)>Pegas/Soluto (AB)>2022>G 1.4 MPI KAPPA>Auto scan>ENG (Engine)>Live data


Odometer Reading: --
 License Plate: --
 Sub Model: --

Customer Information

Name: -- Tel: --

Device Information

Scanner: MaxiSys MS909EV
 Version: V9.23
 Serial Number: VA9GR4C01193

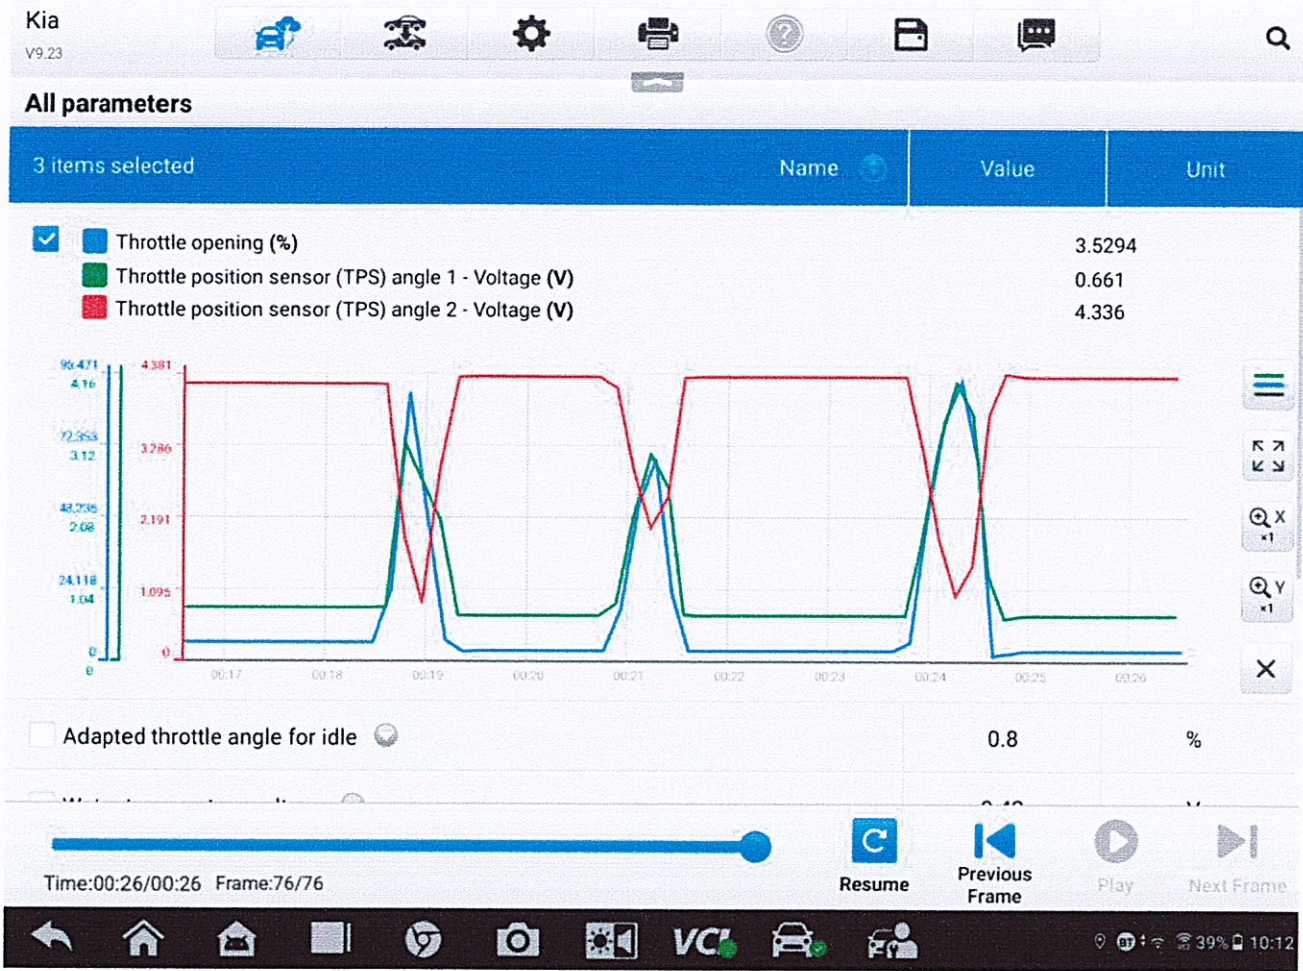

Engine: 88%