



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **URVAN**

Date : **16/8/2026**

Plate No. :

Time : **9:00**

Model : **2022** Color : **WHITE**

Type of Check : Engine + gear + chassis + paint

VIN: JN6BE6CS7N9426861

128872KM

Change tyres + alignment

Scratches + dents on body + body paint damage & faded

Rear left fender repaired + rust under the car

Bolts between engine & gearbox open before

Front engine oil seal + engine crankcase leak

Change engine belt & bearings + service for differential

Please check attached diagnosis computer report

Paint :

Front face + front left fender + rear left fender

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

للخيسة - قطر

Customer Service

+974 40082021

خدمة العملاء



Shop: Golden Munich Cars Inspection
Tel: 66338337
Email: golden.munich@outlook.com
Address: SALWA ROAD-AIN KHALED -DOHA QATAR

Report ID: MAXIA20260816091305
Test Time: 2026-08-16 09:13:05
Technician: --

2022/07- Nissan Vehicle Diagnostic Report

Vehicle Information

2022/07-/Nissan/NV350 urvan/
VIN: --

Odometer Reading: 128872km
License Plate: --

Customer Information

Name: --

Tel: --

Device information

Scanner: MaxiSys MS909
Version: V6.00

Serial Number: V19GM7C01221
Repair Order Number:
V19GM7C0122120260816091158215

System Scanned(7)

System	Status/DTC
Engine	 0
ABS	 2
Air bag	 0
Meter/M&A	 0
Air pressure monitor	 0
BCM	 3
IPDM E/R	 0

DTC (5)

ABS (2 DTCs)

DTC	Description	Status
C1109	Battery voltage (abnormal)	Past
C1143	Steering angle sensor circuit	Past

BCM (3 DTCs)

DTC	Description	Status
U1000	CAN communication circuit	Past
B2193	Chain OF BCM-ECM	Past
B26E7	TPMS CAN communication	Past





Shop: Golden Munich Cars Inspection
Tel: 66338337
Email: golden.munich@outlook.com
Address: SALWA ROAD AIN KHALED - DOHA QATAR

Report ID: MAXIA20260816091305
Test Time: 2026-08-16 09:13:05
Technician: --

2022/07- Nissan Vehicle Diagnostic Report

Vehicle Information

2022/07-/Nissan/NV350 urvan

VIN: --

Path: Nissan>Manual selection>Middle and near east>Qatar>NV350 urvan>E26>2022/07->Auto scan>Engine>Live data

Odometer Reading: 128872 km

License Plate: --

Sub Model: E26

Customer Information

Name: --

Tel: --

Device information

Scanner: MaxiSys MS909

Serial Number: V19GM7C01221

Version: V6.00

Nissan
V6.00



All signals ▾

2 items selected


Name

Value

Unit

Accelerator sensor 1(V)

0.75

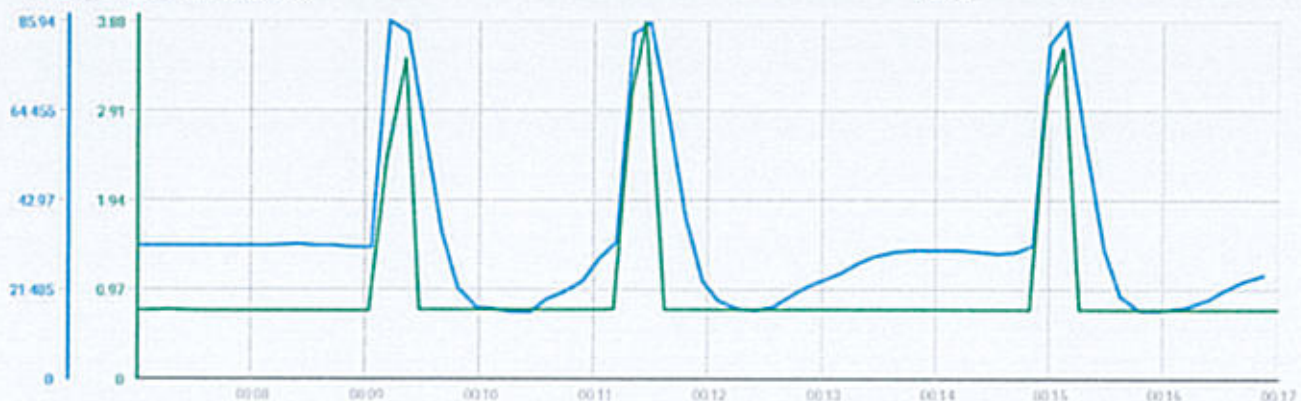

☐ Ho2s2 (b1)

0.49

V

☐ Intake valve timing (bank 1)

0.5

° CA

☐ Intake valve solenoid (bank 1)

0

%

Time:00:17/00:17 Frame:90/90

Resume

Previous
Frame

Play

Next Frame

Engine: 90%

