



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارات
Computerized Testing For All Kind of Cars



Car : PEGAS

Date : 15/8/2026

Plate No. :

Time : 10:00

Model : 2022 Color : WHITE

Type of Check : Engine + gear + chassis + paint

VIN: LJD0AA295N0170696

156672KM

Change tyres + alignment

Scratches + dents on body + rear face linear bend

Under the car & chassis scratches by stones + lower cover broken

Timing gasket leak + service brake + CHECK ENGINE

Change arm bushes + shock absorber

Please check attached diagnosis computer report

Paint :

Plastic kit

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة موآتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

2022 Kia(Europe) Vehicle Diagnostic Report

Vehicle Information

2022/Kia(Europe)/Pegas/Soluto (AB)/G 1.4 MPI KAPPA
VIN: LJD0AA295N0170696Odometer Reading: --
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V9.30Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260815100257244

System Scanned (10)

System	Status/DTC
ENG (Engine)	 1
A/T (Transaxle)	 0
ABS/ESC (Anti Lock Brake/Electronic Stability Control)	 0
AB (Airbag)	 0
CLU (Cluster Module)	 0
TPMS (Tire Pressure Monitoring System)	 0
BCM (Body Control)	 0
IMMO (Immobilizer)	 0
CODE (Transmitter Code Saving)	 0
EPS (Motor Driven Power Steering)	 0

DTC (1)

ENG (Engine) (1 DTC)

DTC	Description	Status
P2096	Post catalyst fuel trim system too lean (Bank 1)	Active

I/M readiness status

Fault codes	Status
MIL status	ON
DTC	1
Monitor status	Status

	MIS	Misfire monitoring	✓
	FUEL	Fuel system monitoring	✓
	CCM	Comprehensive component monitoring	✓
	CAT	Catalyst monitoring	✓
	HCAT	Heated catalyst monitoring	⊘
	EVAP	Evaporative system monitoring	⊘
	AIR	Secondary air system monitoring	⊘
	O2S	Oxygen sensor monitoring	✓
	HTR	Oxygen sensor heater monitoring	✓
	EGR	EGR system monitoring	✓

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

2022 Kia Vehicle Diagnostic Report

Vehicle Information

2022/Kia/Pegas/Soluto (AB)/G 1.4 MPI KAPPA

VIN: LJD0AA295N0170696

Path: Kia>Automatic selection>Auto scan>ENG (Engine)>Live data

Odometer Reading: --

License Plate: --

Sub Model: --

Customer Information

Name: --


Tel: --

Device Information

Scanner: MaxiSys MS909EV

Version: V9.30

Serial Number: VA9GR4C01193

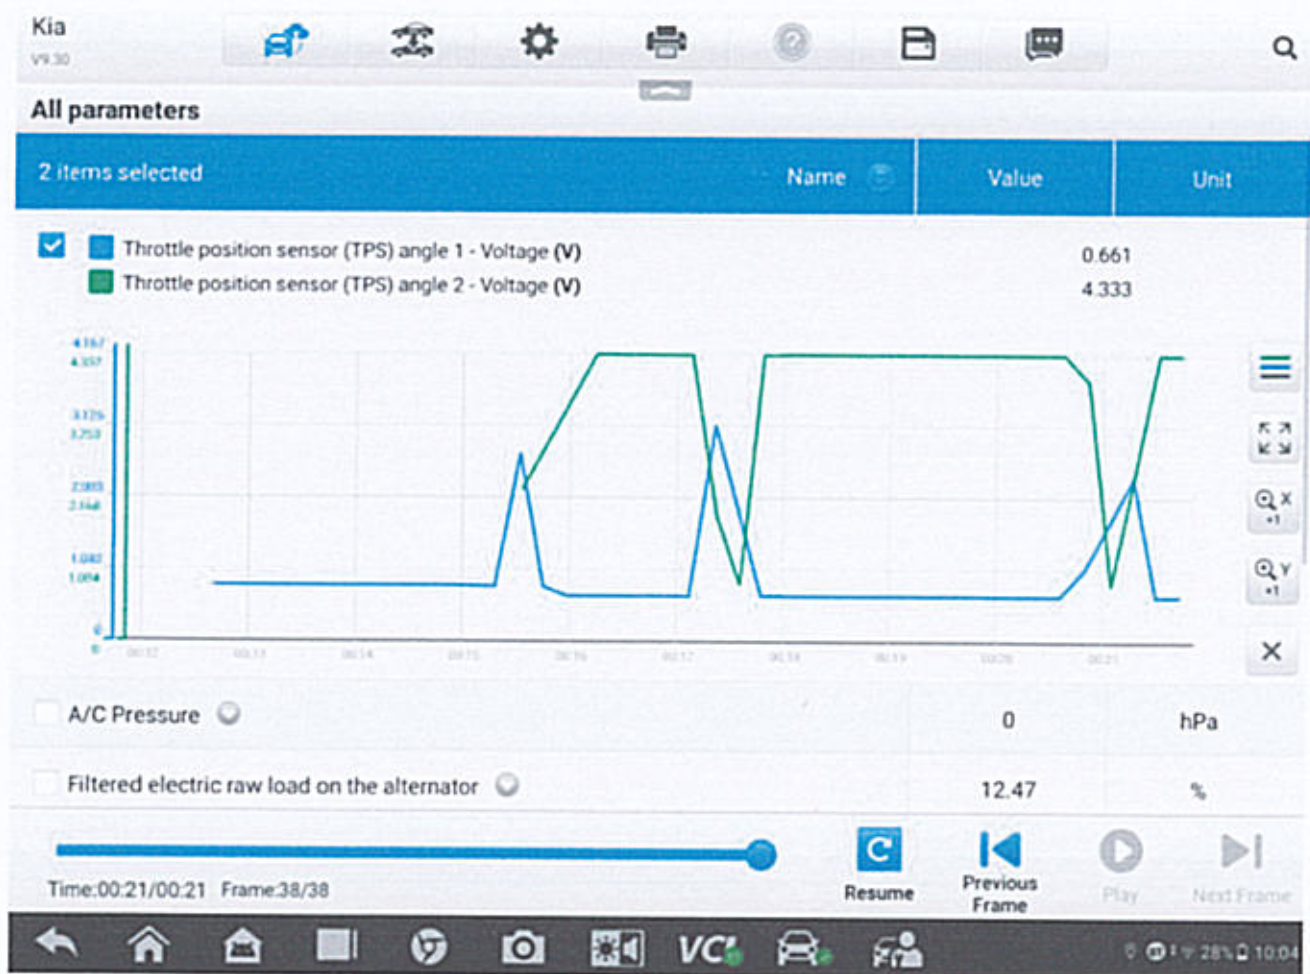

Engine: 88%