



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **CR-V**

Date : **15/8/2026**

Plate No. :

Time : **13:02**

Model : **2022** Color : **SILVER**

Type of Check : **Engine +gear+chassis+paint**

VIN: **5J6RW685XNL700620**

79530KM

Scratches + dents on body + plastic kit + rims scratched

Front bumper loose + front right fender bend

Rust on mechanical parts + service brake

Thank you for choosing Golden Munich cars inspection

Paint:

Front bumper

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

2022 Honda Vehicle Diagnostic Report

Vehicle Information

2022/Honda/CR-V/
VIN: 5J6RW685XNL700620Odometer Reading: 79530Km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V7.32Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260815091428229

System Scanned (13)

System	Status/DTC
PGM-FI	 0
AT	 0
ABS/VSA	 1
SRS/SWS/PUH	 0
Gauges	 0
Body Electrical	  1
Electric Brake Booster	 1
EPS	 0
Power Control Unit	 0
Backup Control Unit	 0
Keyless access Control Unit	 0
IMMOBI	 0
Real Time AWD/AWD with Intelligent Control	 0

DTC (3)

ABS/VSA (1 DTC)

DTC	Description	Status
C0077-78	Low Tire Air Pressure	Confirmed DTCs

Body Electrical (1 DTC)

DTC	Description	Status
B1380	Tailgate Closer Unit Neutral switch circuit malfunction	Confirmed DTCs

Electric Brake Booster (1 DTC)

DTC	Description	Status
U3003-16	Brake Booster Control Unit Power Circuit (+B) Low Voltage	Confirmed DTCs

 I/M readiness status

Fault codes	Status
MIL status	OFF
DTC	0

Monitor status			Status
	MIS	Misfire monitoring	
	FUEL	Fuel system monitoring	
	CCM	Comprehensive component monitoring	
	CAT	Catalyst monitoring	
	HCAT	Heated catalyst monitoring	
	EVAP	Evaporative system monitoring	
	AIR	Secondary air system monitoring	
	O2S	Oxygen sensor monitoring	
	HTR	Oxygen sensor heater monitoring	
	EGR	EGR system monitoring	

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

2022 Honda Vehicle Diagnostic Report

Vehicle Information

2022/Honda/CR-V
VIN: 5J6RW685XNL700620
Path: Honda>Automatic
selection>5J6RW685XNL700620>GENERAL>CR-V>2022>Auto
scan>PGM-FI>Live data

Odometer Reading: 79530 Km
License Plate: -
Sub Model: GENERAL

Customer Information


Name: -

Tel: -

Device Information

Scanner: MaxiSys MS909EV
Version: V7.32

Serial Number: VA9GR4C01193

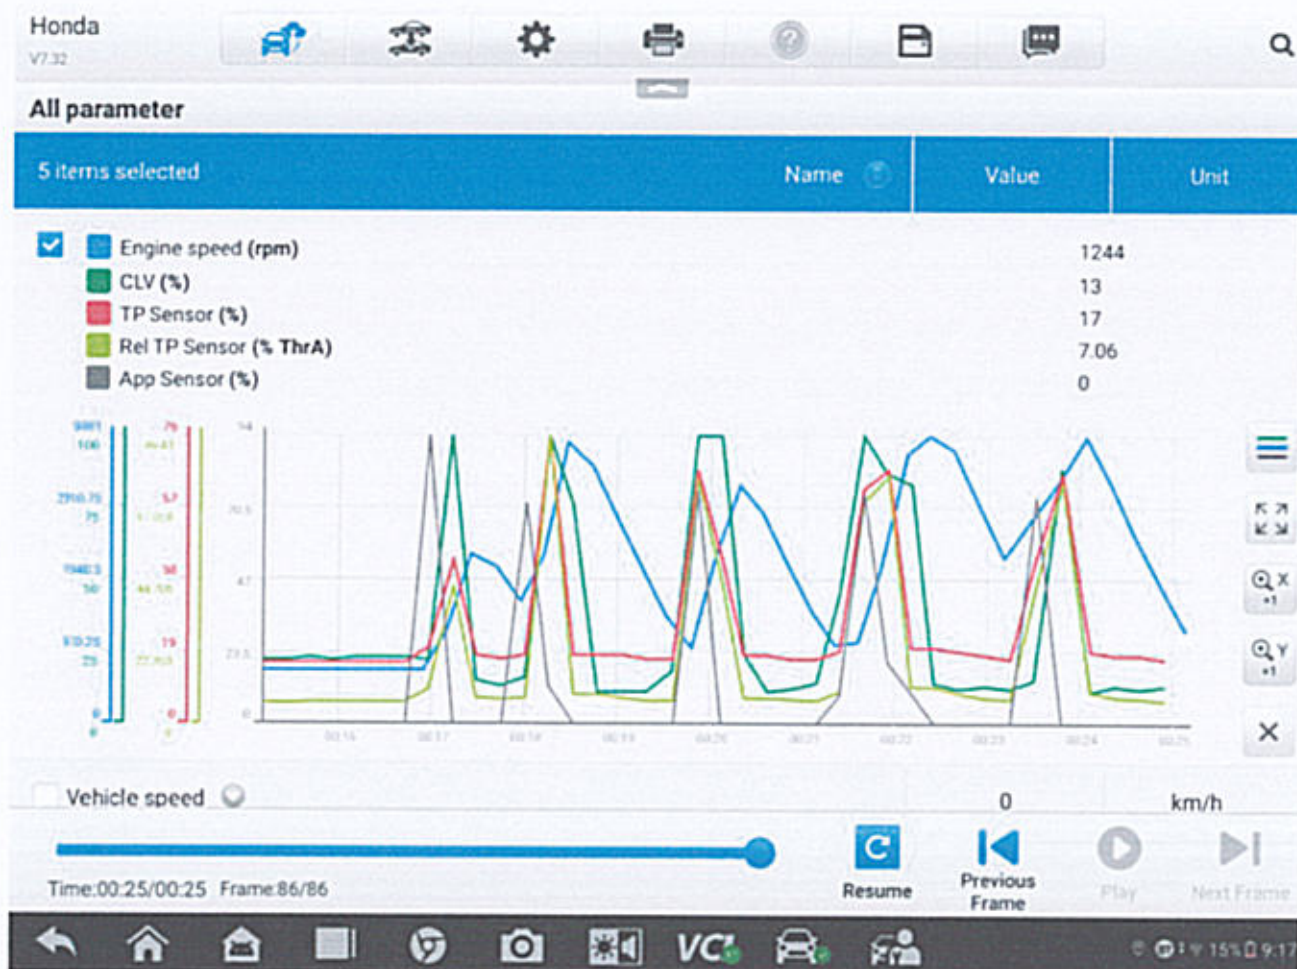

Engine 90 %