



ميونخ الذهبي لفحص السيارات ذ.م.م.

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة

Computerized Testing For All Kind of Cars



Car : **PATROL**

Date : **17/8/2026**

Plate No. : **884180**

Time : **10:00**

Model : **2023** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN: JN8BY2NY9P9407546

350072KM

Change tyres + alignment

Scratches + dents on body + 2 right doors & 2 right fenders bend

Front face sand damage+front right fender paint damage+driver handle missing

Clay under the car & mechanicals parts (bolts not checked)

Engine gasket + bolts between engine & gearbox open before

AC compressor make sound + service for differential + service brake

Service for water circulation & temperature

Change engine & gearbox mounting + front differential mounting

Service for front & rear over haul suspension + shock absorber

Change bonnet shock absorber + service for gearbox

Please check attached diagnosis computer report

Paint :

No paint on body

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء



Shop: Golden Munich Cars Inspection
Tel: 66338337
Email: golden.munich@outlook.com
Address: SALWA ROAD-AIN KHALED -DOHA QATAR

Report ID: MAXIA20260817095509
Test Time: 2026-08-17 09:55:09
Technician: --

2023 Nissan Vehicle Diagnostic Report

Vehicle Information

2023/Nissan/Armada/
VIN: JN8BY2NY9P9407546

Odometer Reading: 350072km
License Plate: --

Customer Information

Name: --

Tel: --

Device information

Scanner: MaxiSys MS909
Version: V6.00

Serial Number: V19GM7C01221
Repair Order Number:
V19GM7C0122120260817095323312

System Scanned(13)

System	Status/DTC
Engine	 1
Transmission	 0
ABS	 0
Air bag	 0
Meter/M&A	 0
Air pressure monitor	 0
All mode AWD/4WD	 1
BCM	 0
HVAC	 2
IPDM E/R	 0
Difference lock	 0
Sonar	 0
3-channel CAN gateway	 0

DTC (4)

Engine (1 DTC)

DTC	Description	Status
P0420	Three-way catalytic converter system (bank 1)	20 time

All mode AWD/4WD (1 DTC)

DTC	Description	Status
-----	-------------	--------



P1817 Shift actuator

Past

HVAC (2 DTCs)

DTC Description

Status

B2631 Sunload sensor

Current

B2668 Pass sunload sensor

Current

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.



Shop: Golden Munich Cars Inspection
Tel: 66338337
Email: golden.munich@outlook.com
Address: SALWA ROAD-AIN KHALED-DOHA QATAR

Report ID: MAXIA20260817095509

Test Time: 2026-08-17 09:55:09

Technician: --

2023 Nissan Vehicle Diagnostic Report

Vehicle Information

2023/Nissan/Armada

VIN: JN8BY2NY9P9407546

Path: Nissan>Automatic selection>Auto scan>Engine>Live data

Odometer Reading: 350072 km

License Plate: --

Sub Model: Y62

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909

Serial Number: V19GM7C01221

Version: V6.00

Nissan
V6.00



All signals ▾

4 items selected

Name

Value

Unit

- ☒ Accelerator sensor 1(V)
- ☒ Accelerator sensor 2(V)
- ☒ Throttle position sensor 1 (bank 1)(V)
- ☒ Throttle position sensor 2 (bank 1)(V)

0.78


0.76

0.94

0.94

x1 QX

x1 QY

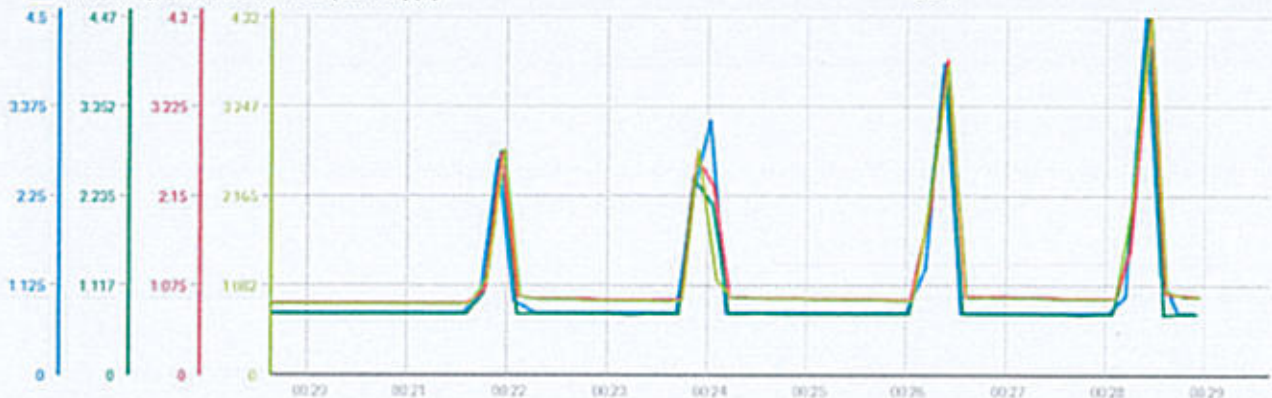

☐ I/p pulley speed

2455

rpm

Time:00:29/00:29 Frame:57/57

Resume

Previous
Frame

Play

Next
Frame



- Engine goes kct open before -

