



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **PATROL**

Date : **16/8/2026**

Plate No. : **859975**

Time : **14:30**

Model : **2023** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN: JN8BY2NY4P9407809

313944KM

Scratches + dents on body + plastic kit damage + front face sand damage

Rear left fender + rear doors two side + upper body panel paint damage

Rear right fender & front & rear bumper & lower cover bend

Engine gasket + bolts between engine & gearbox open before

Valve cover gasket leak + change rear arm bushes + differential mounting

Change steering rubber + axle boot + service for axle + CHECK ENGINE

Change battery+service for gearbox shifting (sound)+alignment for hand brake

Change bonnet shock absorber

Thank you for choosing Golden Munich cars inspection

Trace sticker on body parts

Paint:

No paint on body

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة موآتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

2023/07- Nissan Vehicle Diagnostic Report

Vehicle Information

2023/Nissan/Patrol (AT)/
VIN: --Odometer Reading: 313944km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V7.20Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260816141242849

System Scanned (12)

System	Status/DTC
Engine	 2
Transmission	 5
ABS	 2
Air bag	 0
Meter/M&A	 0
Air pressure monitor	 4
BCM	 3
All mode AWD/4WD	 2
HVAC	 2
IPDM E/R	 0
Difference lock	 0
3-channel CAN gateway	 1

DTC (21)

Engine (2 DTCs)

DTC	Description	Status
P0603	ECM back UP/CIRCUIT	13 Time
P0430	TW catalyst sys-b2	1 time

Transmission (5 DTCs)

DTC	Description	Status
P0725	Engine speed	Past
P0717	Input speed sensor A	Past

P0720	Output speed sensor	Past
U1000	CAN communication circuit	Past
P0744	Torque converter	Past

ABS (2 DTCs)

DTC	Description	Status
C1109	Battery voltage (abnormal)	Past
U1000	CAN communication circuit	Past

Air pressure monitor (4 DTCs)

DTC	Description	Status
C1765	Left front wheel sensor	Past
C1766	Right front wheel sensor	Past
C1767	Left rear wheel sensor	Past
C1768	Right rear wheel sensor	Past

BCM (3 DTCs)

DTC	Description	Status
U1000	CAN communication	Past
U0415	Vehicle speed	Past
B2562	Low voltage	Past

All mode AWD/4WD (2 DTCs)

DTC	Description	Status
P182B	Lock position sensor	Current
P1830	ABS OP signal	111 Time

HVAC (2 DTCs)

DTC	Description	Status
B2631	Sunload sensor	Current
B2668	Pass sunload sensor	Current

3-channel CAN gateway (1 DTC)

DTC	Description	Status
U1000:01	CAN communication circuit (Electrical fault)	Past

** I/M readiness status**

Fault codes	Status
MIL status	ON
DTC	1
Monitor status	Status

	MIS	Misfire monitoring	✓
	FUEL	Fuel system monitoring	✓
	CCM	Comprehensive component monitoring	✓
	CAT	Catalyst monitoring	✓
	HCAT	Heated catalyst monitoring	⊘
	EVAP	Evaporative system monitoring	⊘
	AIR	Secondary air system monitoring	⊘
	O2S	Oxygen sensor monitoring	✓
	HTR	Oxygen sensor heater monitoring	✓
	EGR	EGR system monitoring	✓

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

2023/07- Nissan Vehicle Diagnostic Report

Vehicle Information

2023/07-/Nissan/Patrol (AT)

VIN: --

Path: Nissan>Manual selection>Middle and near east>Qatar>Patrol (AT)>Y62>2023/07->Auto scan>Engine>Live data

Odometer Reading: 313944 km

License Plate: --

Sub Model: Y62

Customer Information

Name: --


Tel: --

Device Information

Scanner: MaxiSys MS909EV

Serial Number: VA9GR4C01193

Version: V7.20

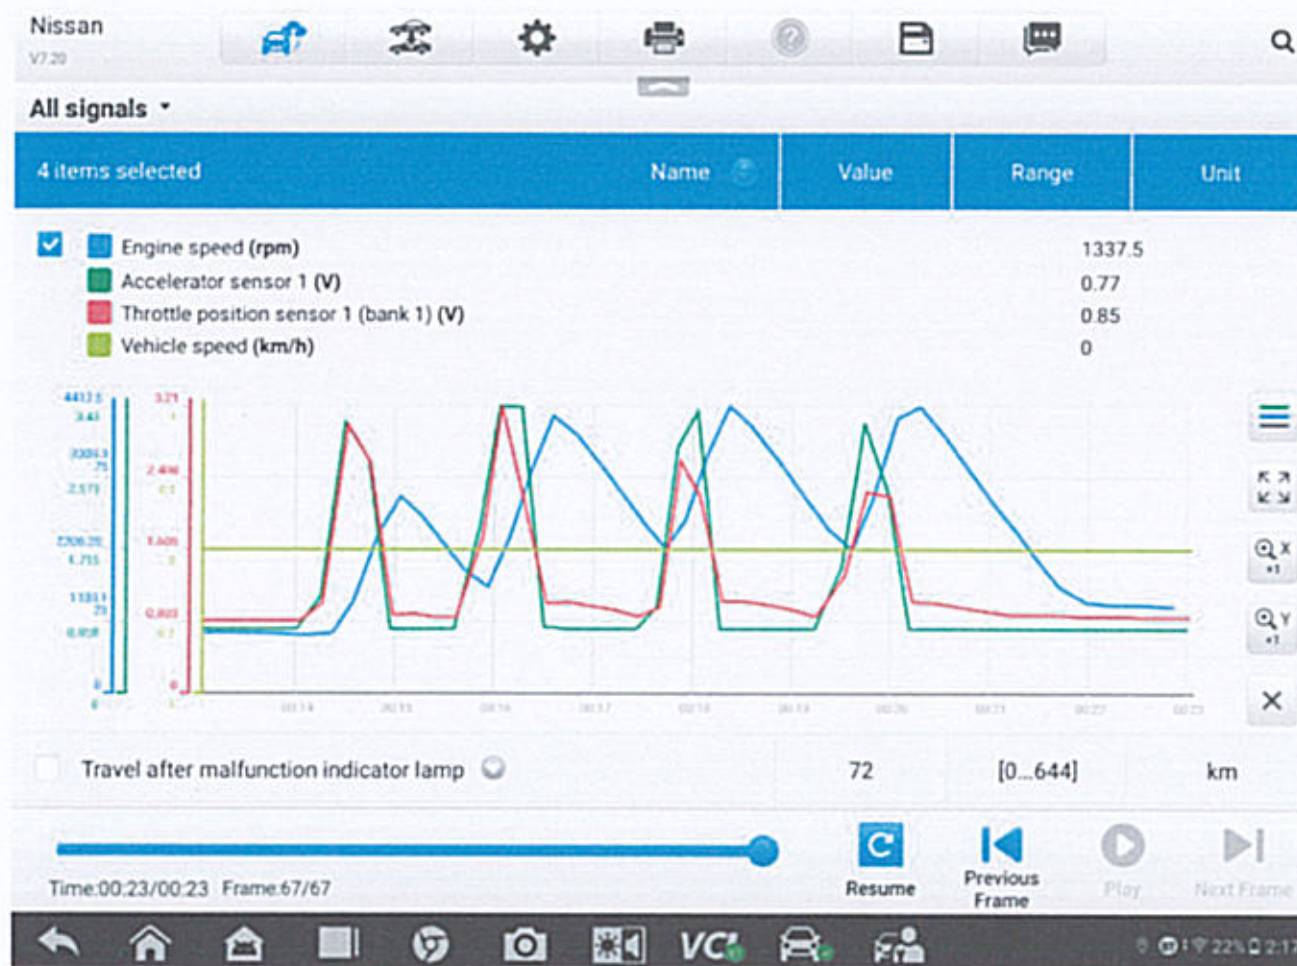

- Engine gasket open before -