



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : **PATROL**

Date : **16/8/2026**

Plate No. : **870471**

Time : **9:00**

Model : **2023** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN: JN8BY2NY8P9406825

320285KM

Change tyres + alignment

Scratches + dents on body + front glass dent + driver handle missing

Front right fender & rear left fender bend + front bumper damage

Rear hook bend on under chassis + petrol tank cover bend

Cover under the car missing + radiator repaired + service for drive shaft

Gearbox crankcase open before & small leak + front axle boot leak

Change engine & gearbox mounting + steering rod + arm bushes

Change tyres bearnings+ bonnet shock absorber + tune up engine

Service for CHECK ENGINE + service for interior AC fan + service brake

Please check attached diagnosis computer report

Paint :

Plastic kit + rear body door

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة موآتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء



Shop: Golden Munich Cars Inspection
Tel: 66338337
Email: golden.munich@outlook.com
Address: SALWA ROAD-AIN KHALED -DOHA QATAR

Report ID: MAXIA20260816090433
Test Time: 2026-08-16 09:04:33
Technician: --

2022/08- Nissan Vehicle Diagnostic Report

Vehicle Information

2022/08-/Nissan/Patrol (AT)/
VIN: --

Odometer Reading: 320285km
License Plate: --

Customer Information

Name: --

Tel: --

Device information

Scanner: MaxiSys MS909
Version: V6.00

Serial Number: V19GM7C01221
Repair Order Number:
V19GM7C0122120260816090238545

System Scanned(13)

System	Status/DTC
Engine	 2
Transmission	 0
ABS	 2
Air bag	 0
Meter/M&A	 0
Air pressure monitor	 1
All mode AWD/4WD	 0
BCM	 2
HVAC	 2
IPDM E/R	 0
Difference lock	 0
Sonar	 0
3-channel CAN gateway	 1

DTC (10)

Engine (2 DTCs)

DTC	Description	Status
P0420	Three-way catalytic converter system (bank 1)	7 time
P0430	TW catalyst SYS-B2	7 time

ABS (2 DTCs)



DTC	Description	Status
C1116	Stop lamp switch	Past
C1142	Pressure sensor circuit	Past

Air pressure monitor (1 DTC)

DTC	Description	Status
C1706	Low pressure (right rear)	Current

BCM (2 DTCs)

DTC	Description	Status
U1000	CAN communication	Past
B2193	Chain OF BCM-ECM	Past

HVAC (2 DTCs)

DTC	Description	Status
B2631	Sunload sensor	Current
B2668	Pass sunload sensor	Current

3-channel CAN gateway (1 DTC)

DTC	Description	Status
U1000:01	CAN COMM circuit (Electrical fault)	Past

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.



Shop: Golden Munich Cars Inspection
Tel: 66338337
Email: golden.munich@outlook.com
Address: SALWA ROAD AIN KHALED - DOHA QATAR

Report ID: MAXIA20260816090433

Test Time: 2026-08-16 09:04:33

Technician: --

2022/08- Nissan Vehicle Diagnostic Report

Vehicle Information

2022/08-/Nissan/Patrol (AT)

VIN: --

Path: Nissan>Manual selection>Middle and near east>Qatar>Patrol
(AT)>Y62>2022/08->Auto scan>Engine>Live data

Odometer Reading: 320285 km

License Plate: --

Sub Model: Y62

Customer Information

Name: --


Tel: --

Device Information

Scanner: MaxiSys MS909

Serial Number: V19GM7C01221

Version: V6.00

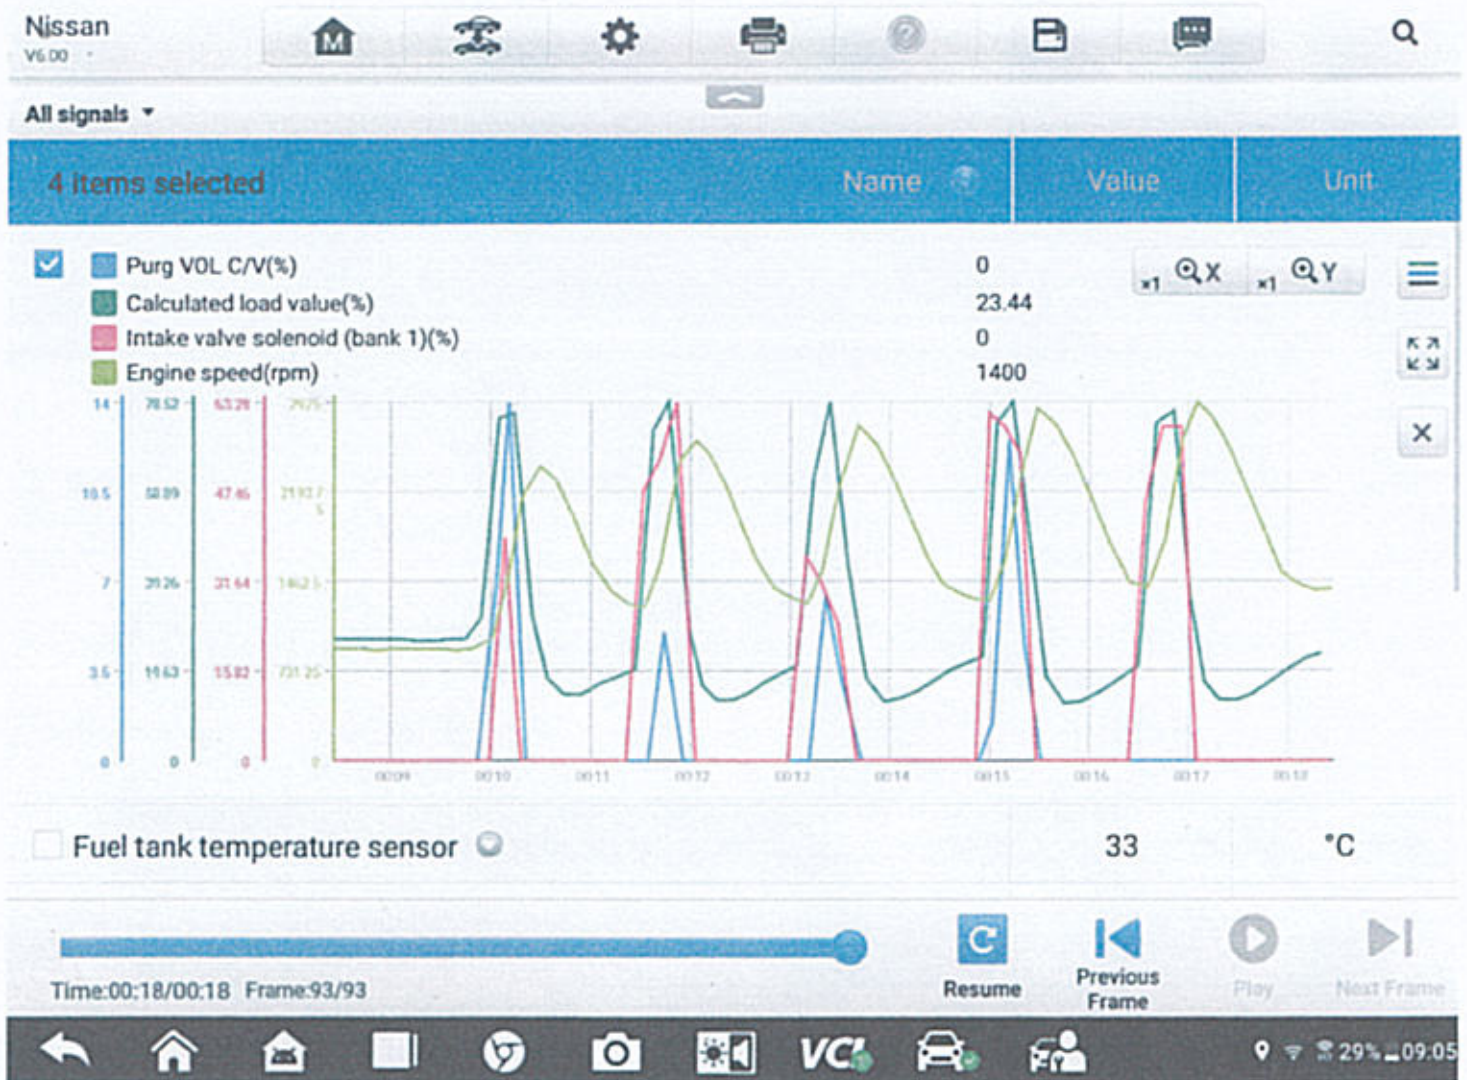

Engine 861