



ميونخ الذهبي لفحص السيارات ذ.م.م.

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة

Computerized Testing For All Kind of Cars



Car : **GS4**

Date : **15/8/2026**

Plate No. : **915770**

Time : **12:00**

Model : **2024** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN: LMGAT1G59R1289948

54738KM

Scratches + dents on body & plastic kit

Oil filter support leak + change brake pads

Please check attached diagnosis computer report

Paint :

Front bumper + front right fender + front right door

Check paint as per customer request

المركز غير مسؤول عن أي اعطال قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة مواتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء



Shop Name: --
Tel: --
Email: --
Address: --

Report ID: MAXIA20260815115900
Test Time: 2026-08-15 11:59:00
Technician: --

GACMotor Vehicle Diagnostic Report

Vehicle Information

--/GACMotor/GS4 MAX/
VIN: LMGAT1G59R1289948

Odometer Reading: --
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V10.10

Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260815115612042

System Scanned (6)

System	Status/DTC
EMS (Engine Management System)	 4
TCU (Dual Clutch Transmission)	 0
BCS (Brake Control System)	 0
SRS (Supplementary Restraint System)	 0
GSM (Gear Shift Module)	 0
GWM (Gateway Module)	 0

DTC (4)

EMS (Engine Management System) (4 DTCs)

DTC	Description	Status
P030000	Misfire of single cylinder or multiple cylinders	Current DTC
P030300	Cylinder 3 misfire detected	Current DTC
P030200	Cylinder 2 misfire detected	Current DTC
P036300	Fuel cut-off caused by engine misfire	Current DTC

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

Disclaimer: This report provides a reference for vehicle inspection and maintenance only. Autel is not liable for any accident, property damage, or personal injury resulting from the use of this information.

GACMotor Vehicle Diagnostic Report

Vehicle Information

GACMotor/GS4 MAX
VIN: LMGAT1G59R1289948
Path: GACMotor>Automatic selection>Auto scan>Engine control module>Live data

Odometer Reading: --
License Plate: --
Sub Model: --

Customer Information


Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V10.10

Serial Number: VA9GR4C01193

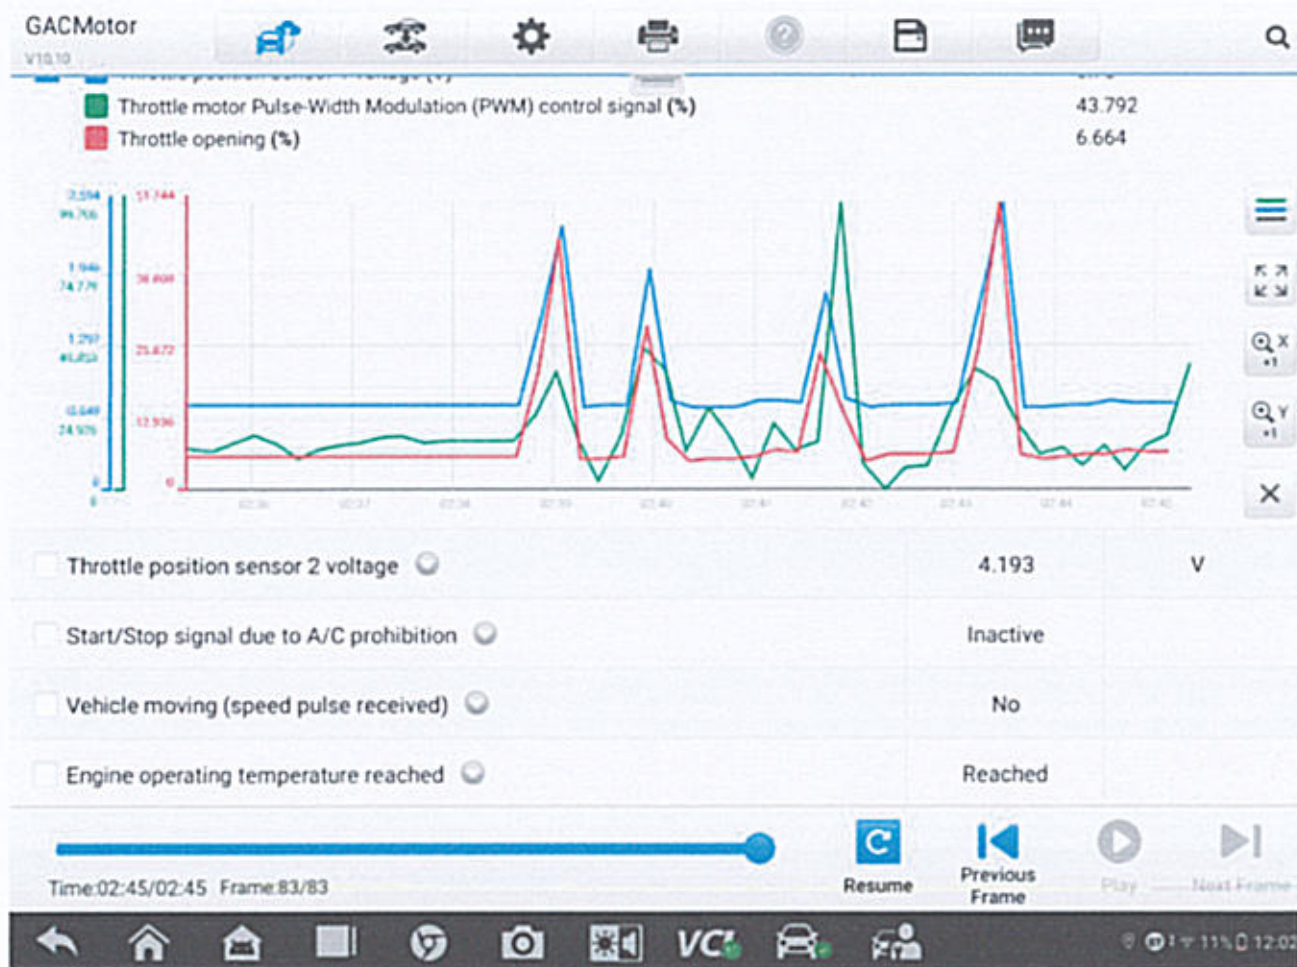

Engine: 93%