



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : XC40

Date : 15/8/2026

Plate No. :

Time : 11:00

Model : 2022 Color : WHITE

Type of Check : Engine + gear + chassis + paint

VIN: YV1AKAXZXN2781933

24973KM

Change front tyres

Scratches + dents on body & plastic kit

Service brake

Please check attached diagnosis computer report

Paint :

No paint on body

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس ماله

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة موآتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

2022 VOLVO Vehicle Diagnostic Report

Vehicle Information

2022/VOLVO/XC40/B3154T4
VIN: YV1AKAXZXN2781933Odometer Reading: 24973 km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V15.20Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260815105522570

System Scanned (26)

System		Status/DTC
CEM (Central Electronic Module)		6
ECM (Engine Control Module)		0
TCM (Transmission Control Module)		0
SRS (Supplemental Restraint System Module)		0
DIM (Driver Information Module)		0
ASDM (Active Safety Domain Master)	ADAS	1
AUD (Audio Module)		0
BMS (Battery Monitoring Sensor)		0
CCM (Climate Control Module)		1
CSD (Center Console Display)		0
DDM (Driver Door Module)		0
EGSM (Electronic Gear Selector Module)		0
HCML (Headlamp Control Module Left)	ADAS	1
HCMR (Headlamp Control Module Right)	ADAS	0
IHU (Infotainment Head Unit)		2
OHC (Overhead Consol Control module)		0
PAC (Parking Assistance Camera Module)	ADAS	0
PDM (Passenger Door Module)		0
PSCM (Power Steering Control Module)		2
SAS (Steering Angle Sensor Module)		0

SCL (Steering Column Lock Module)	✓ 0
SWM (Steering Wheel Module)	✓ 0
TACM (Transmission Actuator Control Module)	✓ 0
VCM (Vehicle Connectivity Module)	✗ 1
VDDM (Vehicle Dynamics Domain Master)	✗ 2
WPC (Wireless Phone Charge)	✓ 0

DTC (16)

CEM (Central Electronic Module) (6 DTCs)

DTC	Description	Status
B149914	Comfort relay control, General electrical faults, Circuit open/short to ground	Confirmed
B14BA13	Fuel flap lock supply voltage, General electrical faults, Circuit open	Confirmed
B14BB13	Fuel flap unlock supply voltage, General electrical faults, Circuit open	Confirmed
B14E912	Sun sensor 1, General electrical faults, Circuit short to battery	Confirmed
B14E914	Sun sensor 1, General electrical faults, Circuit open/short to ground	Confirmed
U110400	Interrupted communication with Climate Control Module (CCM), General fault information, No sub-type information	Unconfirmed

ASDM (Active Safety Domain Master) (1 DTC)

DTC	Description	Status
U2C6292	Invalid signal received from another control module, Component faults, Performance/operation fault	Confirmed

CCM (Climate Control Module) (1 DTC)

DTC	Description	Status
B157C96	Seat Module Left (SML) - height motor, Component faults, Component internal fault	Unconfirmed

HCML (Headlamp Control Module Left) (1 DTC)

DTC	Description	Status
U100246	Data integrity fault in NVM, System internal faults, Calibration/parameter memory fault	Confirmed

IHU (Infotainment Head Unit) (2 DTCs)

DTC	Description	Status
-----	-------------	--------

B130086	Video output 'A', Bus signal/message faults, Signal invalid	Confirmed
U1A2500	MOST ring completed. Signal missing, General fault information, No sub-type information	Confirmed

PSCM (Power Steering Control Module) (2 DTCs)

DTC	Description	Status
U112B87	Interrupted communication with Central Electronic Module (CEM), Bus signal/message faults, Message missing	Confirmed
U300004	Control module, General fault information, System internal faults	Confirmed

VCM (Vehicle Connectivity Module) (1 DTC)

DTC	Description	Status
U103A47	Router CPU, System internal faults, Watchdog/safety µC fault	Unconfirmed

VDDM (Vehicle Dynamics Domain Master) (2 DTCs)

DTC	Description	Status
C007768	Low tire pressure, Algorithm based faults, Event information	Confirmed
U010000	Lost communication with ECM, General fault information, No sub-type information	Confirmed

I/M I/M readiness status

Fault codes	Status
MIL status	OFF
DTC	0

Monitor status	Status
----------------	--------

	MIS	Misfire monitoring	✓
	FUEL	Fuel system monitoring	✓
	CCM	Comprehensive component monitoring	✓
	CAT	Catalyst monitoring	✓
	HCAT	Heated catalyst monitoring	⊘
	EVAP	Evaporative system monitoring	⊘
	AIR	Secondary air system monitoring	⊘
	O2S	Oxygen sensor monitoring	✓
	HTR	Oxygen sensor heater monitoring	✓

2022 VOLVO Vehicle Diagnostic Report

Vehicle Information

2022/VOLVO/XC40/B3154T4
VIN: YV1AKAXZXN2781933
Path: VOLVO>Automatic
selection>2022>XC40>B3154T4>AWF8G30 FWD>Auto scan>ECM
(Engine Control Module)>Live data

Odometer Reading: 24973 km
License Plate: -
Sub Model: -

Customer Information


Name: -

Tel: -

Device Information

Scanner: MaxiSys MS909EV
Version: V15.20

Serial Number: VA9GR4C01193

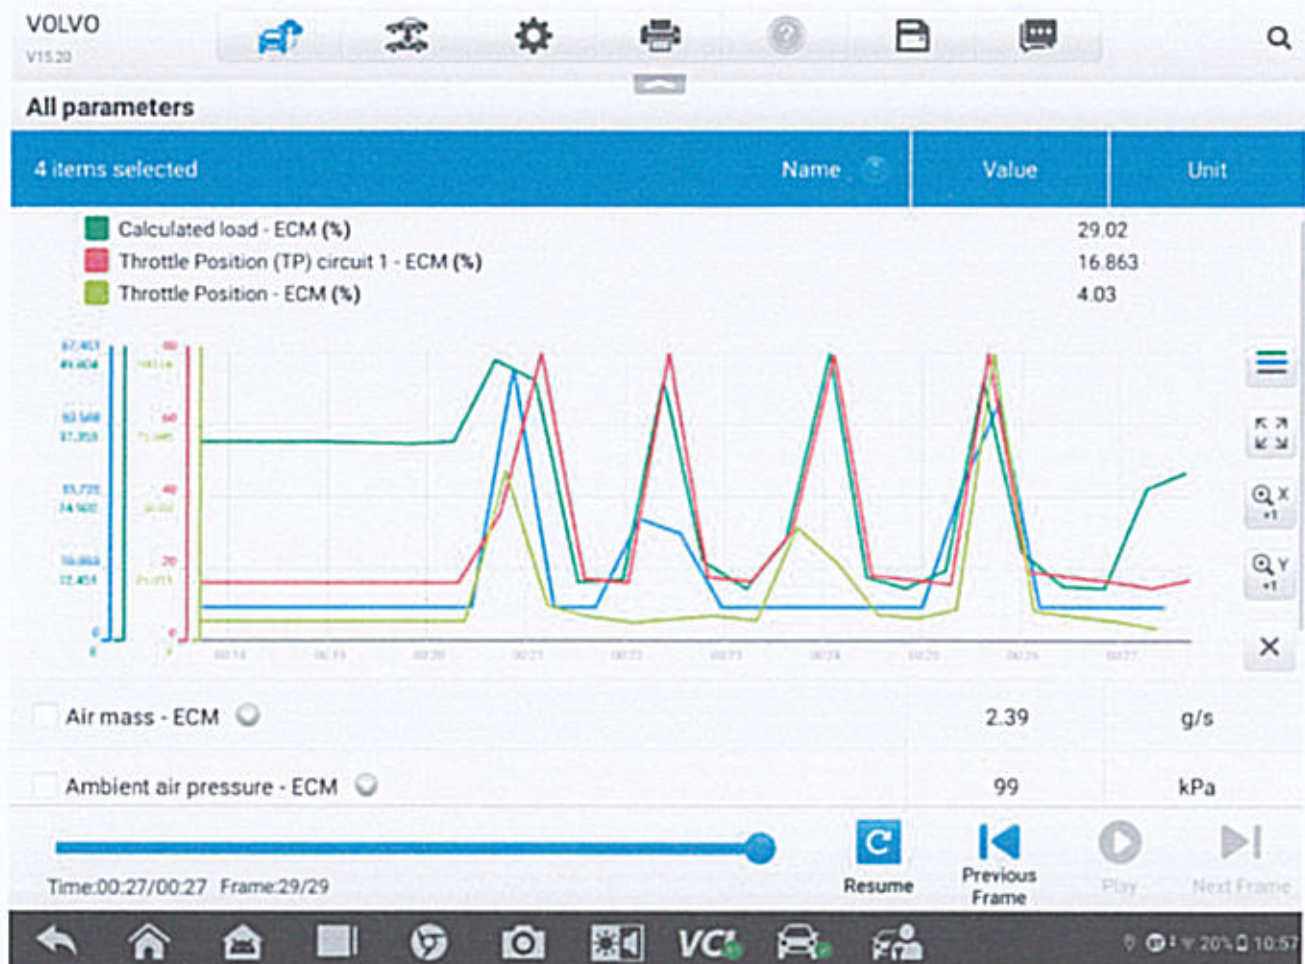

Engine: 96%