



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة

Computerized Testing For All Kind of Cars



Car : **PATROL**

Date : **16/8/2026**

Plate No. : **872324**

Time : **14:52**

Model : **2023** Color : **WHITE**

Type of Check : **Engine +gear+chassis+paint**

VIN: JN8BY2NY0P9406575

246872KM

Scratches + dents on body + body paint damage + bonnet small bend

Trunk door kit loose + rear right fender & body right side repaired

Rust under car & chassis + center chassis bend + service for drive shaft

Rear engine oil seal + engine crankcase leak + change engine belt + bearings

Service for radiator + water circulation & temperature

Service for CHECK ENGINE + change battery + service for charging system

Service for gearbox + engine fan + AC compressor

Change front & rear arm bushes + change engine & gearbox mounting

Thank you for choosing Golden Munich cars inspection

Paint:

Plastic kit + rear body door + all right side + front left fender

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالسيارة اثناء الفحص أو بعده

* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة موآتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخيصة - قطر

Customer Service

+974 40082021

خدمة العملاء

2023 Nissan Vehicle Diagnostic Report

Vehicle Information

2023/Nissan/Armada/
VIN: JN8BY2NY0P9406575

Odometer Reading: 246872km
License Plate: --

Customer Information

Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V7.20

Serial Number: VA9GR4C01193
Repair Order Number:
VA9GR4C0119320260816142912321

System Scanned (13)

System	Status/DTC
Engine	 1
Transmission	 0
ABS	 2
Air bag	 0
Meter/M&A	 0
Air pressure monitor	 0
BCM	 0
All mode AWD/4WD	 2
HVAC	 2
IPDM E/R	 0
Difference lock	 0
Sonar	 0
3-channel CAN gateway	 0

DTC (7)

Engine (1 DTC)

DTC	Description	Status
P0430	TW catalyst sys-b2	3 Time

ABS (2 DTCs)

DTC	Description	Status
C1116	Stop lamp switch	Past
C1187	Dif lock controller	Past

All mode AWD/4WD (2 DTCs)

DTC	Description	Status
P180B	Offroad switch	111 Time
P1830	ABS OP signal	111 Time

HVAC (2 DTCs)

DTC	Description	Status
B2631	Sunload sensor	Current
B2668	Pass sunload sensor	Current

I/M I/M readiness status

Fault codes	Status
MIL status	ON
DTC	1

Monitor status	Status
 MIS Misfire monitoring	✓
 FUEL Fuel system monitoring	✓
 CCM Comprehensive component monitoring	✓
 CAT Catalyst monitoring	✓
 HCAT Heated catalyst monitoring	⊘
 EVAP Evaporative system monitoring	⊘
 AIR Secondary air system monitoring	⊘
 O2S Oxygen sensor monitoring	✓
 HTR Oxygen sensor heater monitoring	✓
 EGR EGR system monitoring	✓

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

2023 Nissan Vehicle Diagnostic Report

Vehicle Information

2023/Nissan/Armada
VIN: JN8BY2NY0P9406575
Path: Nissan>Automatic selection>Auto scan>Engine>Live data

Odometer Reading: 246872 km
License Plate: --
Sub Model: Y62

Customer Information


Name: --

Tel: --

Device Information

Scanner: MaxiSys MS909EV
Version: V7.20

Serial Number: VA9GR4C01193

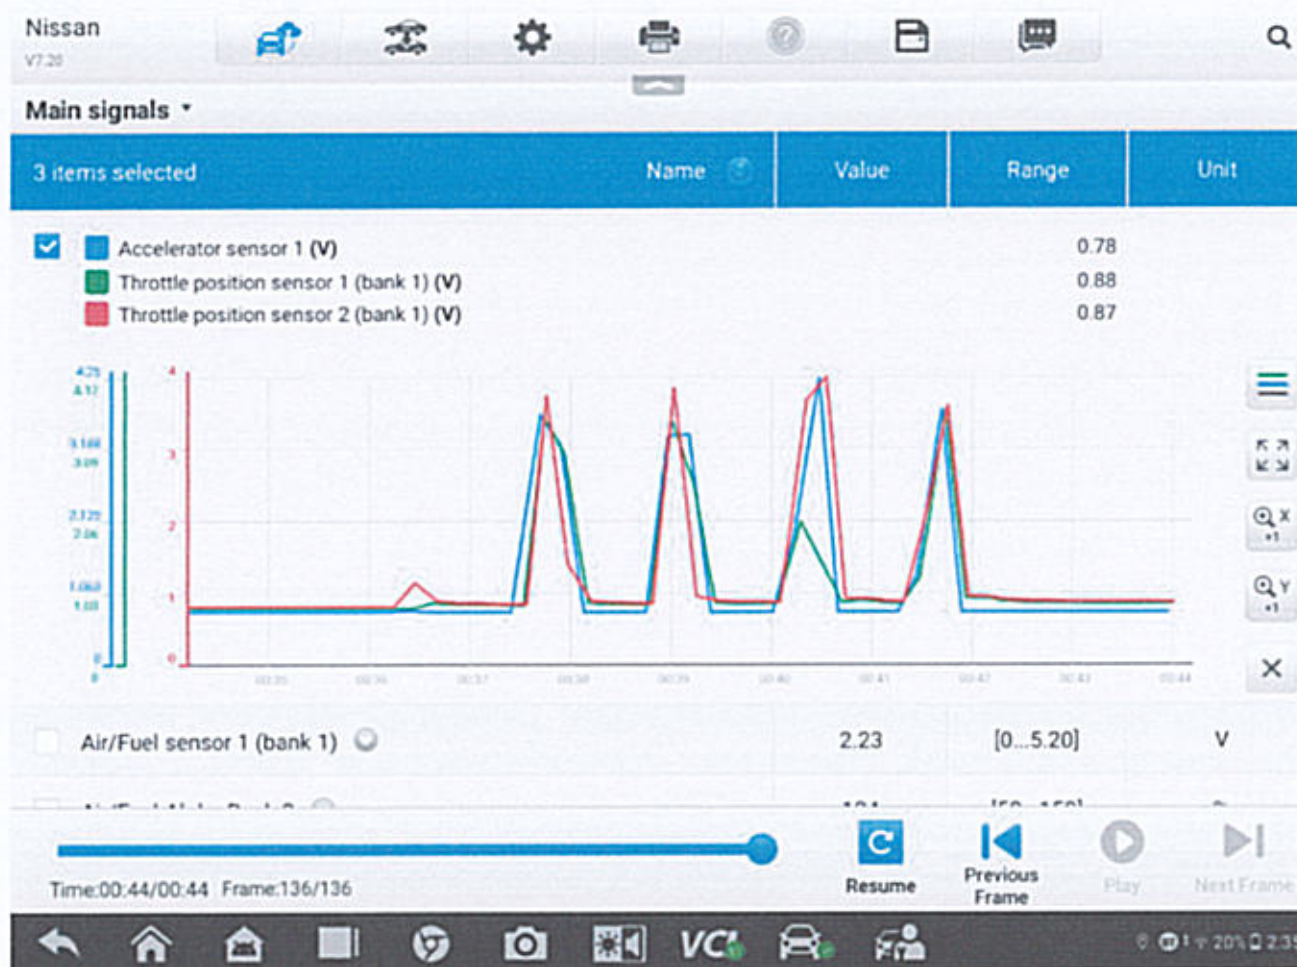

Engine 88 %