



ميونخ الذهبي لفحص السيارات ذ.م.م

Golden Munich Cars Inspection W.L.L

فحص بالكمبيوتر لجميع انواع السيارة
Computerized Testing For All Kind of Cars



Car : PEGAS

Date : 15/8/2026

Plate No. :

Time : 10:00

Model : 2022 Color : RED

Type of Check : Engine + gear + chassis + paint

VIN: LJD0AA297N0170795

145905KM

Change tyres + alignment

Scratches on body + roof paint damage + front left door corner bend

Under the car & chassis scratches by stones + lower cover broken

Rear face linear bend + rear iron bumper support bend

Timing gasket start leak + service for CHECK ENGINE

Change engine mounting + front arm bushes + service brake

Please check attached diagnosis computer report

Paint :

Plastic kit + rear body door + front left fender

Check paint as per customer request

المركز غير مسؤول عن أي اضرار قد تظهر بالمسحاة اثناء الفحص أو بعده
* Center is not responsible for any damage may show car of examination or Later

Munich Al Thahaby Vehicle Inspection W.L.L. its capital limits

ميونخ الذهبي لفحص السيارات ذ.م.م. حدودها رأس مالها

Salwa Road - Ain Khaled - Qatar

+974 66338337

طريق سلوى - عين خالد - قطر

Mawater City - Rawdat Rashed - Qatar

+974 66332237

مدينة موآتر - روضة راشد - قطر

Al Kheesa Qatar

+974 66332237

الخبسة - قطر

Customer Service

+974 40082021

خدمة العملاء



Shop: Golden Munich Cars Inspection
Tel: 66338337
Email: golden.munich@outlook.com
Address: SALWA ROAD-AIN KHALED -DOHA QATAR

Report ID: MAXIA20260815100057
Test Time: 2026-08-15 10:00:57
Technician: --

2022 Kia(Europe) Vehicle Diagnostic Report

Vehicle Information

2022/Kia(Europe)/Pegas/Soluto (AB)/G 1.4 MPI KAPPA
VIN: LJD0AA297N0170795

Odometer Reading: --

License Plate: --

Customer Information

Name: --

Tel: --

Device information

Scanner: MaxiSys MS909

Version: V7.60

Serial Number: V19GM7C01221

Repair Order Number:
V19GM7C0122120260815100037154

System Scanned(10)

System	Status/DTC
ENG (Engine)	 1
A/T (Transaxle)	 0
ABS/ESC (Anti Lock Brake/Electronic Stability Control)	 0
AB (Airbag)	 0
CLU (Cluster Module)	 0
TPMS (Tire Pressure Monitoring System)	 0
BCM (Body Control)	 0
IMMO (Immobilizer)	 0
CODE (Transmitter Code Saving)	 0
EPS (Motor Driven Power Steering)	 0

DTC (1)

ENG (Engine) (1 DTC)

DTC	Description	Status
P2096	Post catalyst fuel trim system too lean (Bank 1)	Active





Shop: Golden Munich Cars Inspection
Tel: 66338337
Email: golden.munich@outlook.com
Address: SALWA ROAD AIN KHALED DOHA QATAR

Report ID: MAXIA20260815100057
Test Time: 2026-08-15 10:00:57
Technician: --

2022 Kia Vehicle Diagnostic Report

Vehicle Information

2022/Kia/Pegas/Soluto (AB)/G 1.4 MPI KAPPA

VIN: LJD0AA297N0170795

Path: Kia>Automatic selection>Auto scan>ENG (Engine)>Live data

Odometer Reading: --

License Plate: --

Sub Model: --

Customer Information

Name: --


Tel: --

Device Information

Scanner: MaxiSys MS909

Serial Number: V19GM7C01221

Version: V7.60

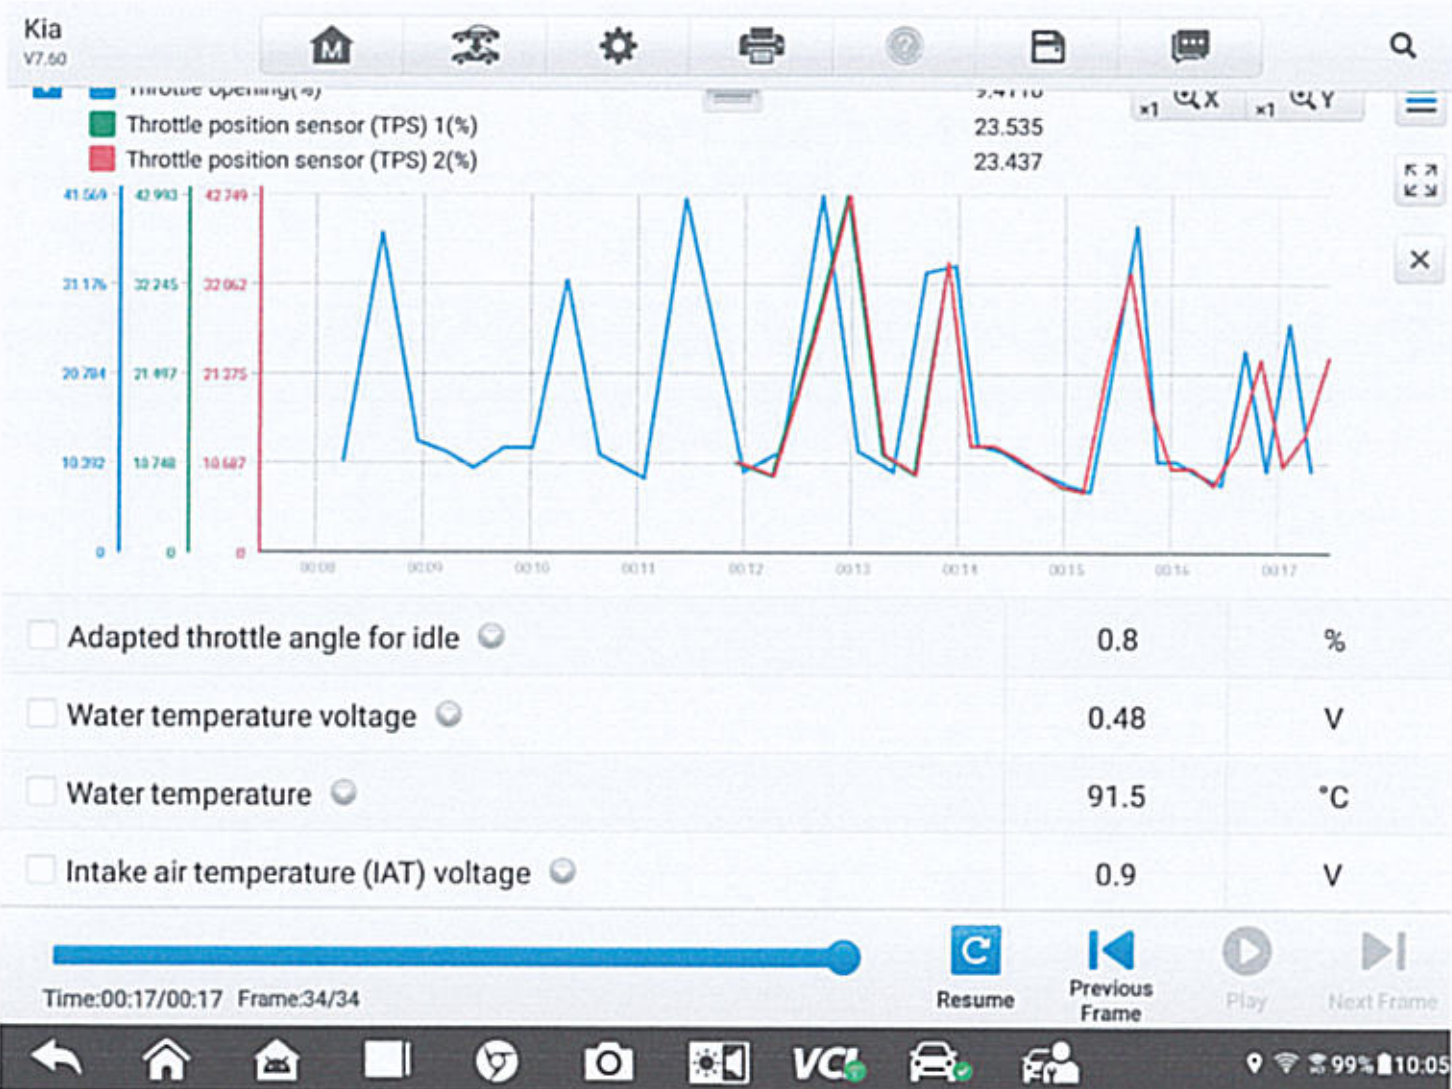

Engine 87%

